



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 1



Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other
Existing Condition: Bus pad 3'-7" long x 5' wide.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Berry Hill Dr. (NB) Photo # 1

Keynote 2



Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other
Existing Condition: 2.2% RS at bus pad , 2.0% RS at the road.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 1 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Berry Hill Dr. (NB) Photo # 1



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 3



Field Condition		1991 ADAAG	10.2.1
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.			
Existing Condition: 2.3% CS at concrete & 4.9% CS at DG.		2004 ADAAG	810.2.4
		2007 CBC	1121B.2.1
		Other	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	62 SF
Total Cost	\$1,442
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Calle Entradero (SB)
Photo # 3

Keynote 4



Field Condition		1991 ADAAG	10.2.1
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).			
Existing Condition: Bus pad 6'-5" long x 5' wide.		2004 ADAAG	810.2.2
		2007 CBC	1121B.1
		Other	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 3 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Calle Entradero (SB)
Photo # 3



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 5



Location: Palos Verdes Dr. W/ Rue Beaupre (NB)
Photo # 5

Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 14" deep seat, 14" high back support, 0" WC shoulder alignment).	2004 ADAAG -
	2007 CBC -
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: Provide compliant bench and relocate to allow 12" shoulder alignment.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 6



Location: Palos Verdes Dr. W/ Rue Beaupre (NB)
Photo # 6

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
Existing Condition: Bus pad 6'-1" long by 5' wide.	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 7 for corrective action.

Costs and Funding	
Qty ...Of:	10 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 7



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 3.1% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	136 SF
Total Cost	\$2,611
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Rue Beaupre (NB)
Photo # 6

Keynote 8



Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
Existing Condition: Bus pad 5' long by 5' wide.	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 9 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Rue Beaupre (SB)
Photo # 8



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 9



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 4.7% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Rue Beaupre (SB) Photo # 8

Keynote 10



Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 3.0% RS at bus pad , 1.5% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 9 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Rue Beaupre (SB) Photo # 8



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 11



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 11" deep seat, 14 1/2" high back support, hazard condition, no 12" shoulder alignment).	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: Provide compliant bench & relocate for clear WC seating space.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Palos Verdes Dr. W (NB) Photo # 11

Keynote 12



Field Condition	
02.13A - Bus Stop Shelter - Clear Floor Area - Clear floor area of 30" by 48" is not completely within the shelter.	1991 ADAAG 10.2.1(2)
Existing Condition: No WC space provided within the shelter.	2004 ADAAG 810.3
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 11 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Palos Verdes Dr. W (NB) Photo # 12



City of Rancho Palos Verdes
**Rancho Palos Verdes ADA Assessment
 Facility Report with Photos**



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 13



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 2.7% to 3.5% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	50 SF
Total Cost	\$960
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	

Location: Hawthorne Blvd./ Palos Verdes Dr. W (NB) Photo # 13

Keynote 14



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 15 3/4" deep seat, 15" high back support).	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: Provide compliant bench with clear WC seating space.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status Not Complete As of 05/09/2013	
Reported By	

Location: Palos Verdes Dr. W/ Hawthorne Blvd. (SB) Photo # 14



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rclds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 15



Location: Palos Verdes Dr. W/ Hawthorne Blvd. (SB)
Photo # 15

Field Condition		1991 ADAAG	10.2.1
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.			
Existing Condition: 4.2% CS.		2004 ADAAG	810.2.4
		2007 CBC	1121B.2.1
		Other	

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 16



Location: Palos Verdes Dr. W/ Hawthorne Blvd. (SB)
Photo # 15

Field Condition		1991 ADAAG	10.2.1
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).			
Existing Condition: Bus pad 6' long by 5' wide.		2004 ADAAG	810.2.2
		2007 CBC	1121B.1
		Other	

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 15 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 17



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Uneven surface.	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	25 SF
Total Cost	\$480
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Palos Verdes Dr. W/ Hawthorne Blvd. (NB)
Photo # 17

Keynote 18



Field Condition	
02.11B - Bus Stop Pad and Accessible Route - Bus stop pad is not connected to an accessible route.	1991 ADAAG 10.2.1
Existing Condition: No accessible route to bus stop.	2004 ADAAG 810.2.3
	2007 CBC 1121B.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate to High

Corrective Action
001A - Accessible Route - Provide new accessible route.
Additional Comments:

Costs and Funding	
Qty ...Of:	500 SF
Total Cost	\$15,000
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ City Hall (NB)
Photo # 18



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 19



Location: Hawthorne Blvd./ City Hall (NB) Photo # 18

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
Existing Condition: bus pad 5'-6" long by 5' wide.	2007 CBC 1121B.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 18 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 20



Location: Hawthorne Blvd./ City Hall (NB) Photo # 18

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.4
Existing Condition: 2.3% to 6.7% RS at bus pad, 2.4% to 4.9% RS at the road.	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 18 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 21



Field Condition			
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG	10.2.1	
Existing Condition: 4.1% to 5.5% CS.	2004 ADAAG	810.2.4	
	2007 CBC	1121B.2.1	
	Other		

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 18 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	
As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ City Hall (NB) Photo # 18

Keynote 22



Field Condition			
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG	10.2.1	
Existing Condition: Bus pad 6' long by 5' wide.	2004 ADAAG	810.2.2	
	2007 CBC	1121B.1	
	Other		

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 23 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	
As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Via Rivera (SB) Photo # 22



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rclds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 23



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 3.9% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Via Rivera (SB) Photo # 22

Keynote 24



Field Condition	
02.11B - Bus Stop Pad and Accessible Route - Bus stop pad is not connected to an accessible route.	1991 ADAAG 10.2.1
Existing Condition: No accessible route to bus stop.	2004 ADAAG 810.2.3
	2007 CBC 1121B.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments:	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Salvation Army (SB) Photo # 24



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 25



Location: Hawthorne Blvd./ Salvation Army (SB)
Photo # 24

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 3.9% to 5.2% RS at bus pad, 7.0% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 27 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	
As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 26



Location: Hawthorne Blvd./ Salvation Army (SB)
Photo # 24

Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 3.9% to 4.5% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 27 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	
As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
**Rancho Palos Verdes ADA Assessment
 Facility Report with Photos**



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 27



Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other
Existing Condition: Bus pad 6'-6" long by 5' wide.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status Not Complete As of 05/09/2013	
Reported By	

Location: Hawthorne Blvd./ Salvation Army (SB) Photo # 24

Keynote 28



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
	2004 ADAAG -
	2007 CBC -
	Other
Existing Condition: Bench (16 1/2" high seat, 15 1/2" deep seat, 17 1/2" high back support).	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: Provide compliant bench with clear WC seating space.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status Not Complete As of 05/09/2013	
Reported By	

Location: Hawthorne Blvd./ Salvation Army (NB) Photo # 28



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 29



Location: Hawthorne Blvd./ Salvation Army (NB) Photo # 28

Field Condition		1991 ADAAG	10.2.1(2)
02.13A - Bus Stop Shelter - Clear Floor Area - Clear floor area of 30" by 48" is not completely within the shelter.			
Existing Condition: No WC space provided within the shelter.		2004 ADAAG	810.3
		2007 CBC	1121B.2.1
		Other	

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 28 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 30



Location: Hawthorne Blvd./ Salvation Army (NB) Photo # 30

Field Condition		1991 ADAAG	10.2.1
02.11B - Bus Stop Pad and Accessible Route - Bus stop pad is not connected to an accessible route.			
Existing Condition: No accessible route to bus pad.		2004 ADAAG	810.2.3
		2007 CBC	1121B.1
		Other	

Corrective Action
001A - Accessible Route - Provide new accessible route.
Additional Comments:

Costs and Funding	
Qty ...Of:	500 SF
Total Cost	\$15,000
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate to High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 31



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 7.1% to 8.3% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	128 SF
Total Cost	\$2,458
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Salvation Army (NB) Photo # 31

Keynote 32



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 14" deep seat, 15" high back support).	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: Provide compliant bench with clear WC seating space.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Vallon Dr. (NB) Photo # 32



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 33



Location: Hawthorne Blvd./ Vallon Dr. (NB)
 Photo # 32

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 7.3% to 10.6 RS at bus pad, 5.6% to 7.0% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	100 SF
Total Cost	\$1,920
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 34



Location: Hawthorne Blvd./ Vallon Dr. (NB)
 Photo # 32

Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 3.0% to 5.0% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 33 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 35



Location: Hawthorne Blvd./ Vallon Dr. (NB) Photo # 32

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other
Existing Condition: Bus pad 6' long by 5' wide.	

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 33 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 36



Location: Hawthorne Blvd./ Vallon Dr. (SB) Photo # 36

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other
Existing Condition: Bus pad 7'-5" long by 5' wide.	

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 37



Location: Hawthorne Blvd./ Vallon Dr. (SB) Photo # 36

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 9.1% RS at bus pad , 10.4% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 36 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 38



Location: Hawthorne Blvd./ Vallon Dr. (SB) Photo # 36

Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 4.4% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 36 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 39



Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other
Existing Condition: Bus pad 5' long by 5' wide.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Dupre Dr. (SB) Photo # 39

Keynote 40



Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other
Existing Condition: 8% RS at bus pad , 10.8% RS at the road.	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: See Keynote 39 for corrective action.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Dupre Dr. (SB) Photo # 39



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 41



Location: Hawthorne Blvd./ Dupre Dr. (NB)
Photo # 41

Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 14" deep seat, 14 1/2" high back support).	2004 ADAAG -
	2007 CBC -
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: Provide compliant bench with clear WC seating space.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 42



Location: Hawthorne Blvd./ Dupre Dr. (NB)
Photo # 41

Field Condition	
02.13A - Bus Stop Shelter - Clear Floor Area - Clear floor area of 30" by 48" is not completely within the shelter.	1991 ADAAG 10.2.1(2)
Existing Condition: No WC space provided within the shelter.	2004 ADAAG 810.3
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 41 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 43



Location: Hawthorne Blvd./ Dupre Dr. (NB)
Photo # 43

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 7.7% to 9.4 RS at bus pad, 6.5% to 7.4% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	50 SF
Total Cost	\$960
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 44



Location: Hawthorne Blvd./ Dupre Dr. (NB)
Photo # 43

Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 3.4% to 3.6% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 43 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 45



Location: Hawthorne Blvd./ Los Verdes Dr. (NB)
Photo # 45

Field Condition

02.17 - Other - Passenger Loading Zones - See Additional Comments

Existing Condition: Bench (16" high seat, 13 1/2" deep seat, 14 1/2" high back support).

1991 ADAAG	-
2004 ADAAG	-
2007 CBC	-
Other	

Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: Provide compliant bench with clear WC seating space.

Costs and Funding

Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0

Status Update (check one)
Completed In Progress Not Complete As of _____ By _____

Classification

DOJ Location Type: 1

Use: PV

Severity: E

Level of Difficulty: Moderate

Implementation

Plan Nbr: DBB

Priority:

Planned Completion

Status Not Complete As of 05/09/2013

Reported By

Keynote 46



Location: Hawthorne Blvd./ Los Verdes Dr. (NB)
Photo # 45

Field Condition

02.13A - Bus Stop Shelter - Clear Floor Area - Clear floor area of 30" by 48" is not completely within the shelter.

Existing Condition: No WC space provided within the shelter.

1991 ADAAG	10.2.1(2)
2004 ADAAG	810.3
2007 CBC	1121B.2.1
Other	

Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 45 for corrective action.

Costs and Funding

Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0

Status Update (check one)
Completed In Progress Not Complete As of _____ By _____

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty: Moderate

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 47



Location: Hawthorne Blvd./ Los Verdes Dr. (NB)
 Photo # 47

Field Condition		
02.11B - Bus Stop Pad and Accessible Route - Bus stop pad is not connected to an accessible route.	1991 ADAAG	10.2.1
Existing Condition: No accessible route to bus stop.	2004 ADAAG	810.2.3
	2007 CBC	1121B.1
	Other	

Corrective Action
001A - Accessible Route - Provide new accessible route.
Additional Comments:

Costs and Funding	
Qty ...Of:	500 SF
Total Cost	\$15,000
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate to High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 48



Location: Hawthorne Blvd./ Los Verdes Dr. (NB)
 Photo # 45

Field Condition		
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG	10.2.1
Existing Condition: Bus pad 6' long by 5' wide.	2004 ADAAG	810.2.2
	2007 CBC	1121B.1
	Other	

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 49



Location: Hawthorne Blvd./ Los Verdes Dr. (NB)
Photo # 47

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 4.7% to 5.7% RS at bus pad, 5.1% to 5.7% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 48 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 50



Location: Hawthorne Blvd./ Los Verdes Dr. (SB)
Photo # 50

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
Existing Condition: Bus pad 3'-11" long by 5' wide.	2004 ADAAG 810.2.2
	2007 CBC 1121B.1
	Other

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 51



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 4.5% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 50 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Los Verdes Dr. (SB) Photo # 50

Keynote 52



Field Condition	
02.11B - Bus Stop Pad and Accessible Route - Bus stop pad is not connected to an accessible route.	1991 ADAAG 10.2.1
Existing Condition: No accessible route to bus stop.	2004 ADAAG 810.2.3
	2007 CBC 1121B.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 50 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Los Verdes Dr. (SB) Photo # 50



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 53



Location: Hawthorne Blvd./ Crest Rd. (SB)
Photo # 53

Field Condition	
02.12A - Bus Stop Pad Slope Parallel to Roadway - Bus stop pad is not at the same slope as the roadway in the direction parallel to the roadway.	1991 ADAAG 10.2.1
Existing Condition: 6.1% RS at bus pad, 6.2% RS at the road.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other


Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 55 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 54

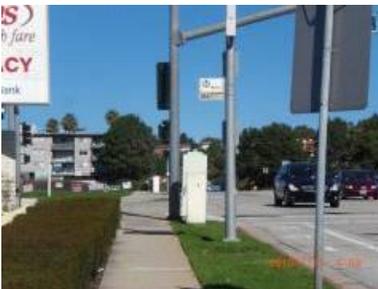

Location: Hawthorne Blvd./ Crest Rd. (SB)
Photo # 53

Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 2.4% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 55 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/>	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 55



Location: Hawthorne Blvd./ Crest Rd. (SB) Photo # 53

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
Existing Condition: Bus pad 4' long by 5' wide.	2007 CBC 1121B.1
	Other

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Keynote 56



Location: Crest Rd./ Hawthorne Blvd. (EB) Photo # 56

Field Condition	
02.11A - Bus Stop Pad Size - Bus stop pad does not measure 8' long (measured from the curb or vehicle roadway edge) by 5' wide (measured parallel to the vehicle roadway).	1991 ADAAG 10.2.1
	2004 ADAAG 810.2.2
Existing Condition: Bus pad 5'-7" long by 5' wide.	2007 CBC 1121B.1
	Other

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 57 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	



City of Rancho Palos Verdes
 Rancho Palos Verdes ADA Assessment
 Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 57



Field Condition	
02.12B - Bus Stop Pad Slope Perpendicular to Roadway - Bus stop pad slope perpendicular to the roadway exceeds 2%.	1991 ADAAG 10.2.1
Existing Condition: 5.0% CS.	2004 ADAAG 810.2.4
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action	
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.	
Additional Comments:	

Costs and Funding	
Qty ...Of:	40 SF
Total Cost	\$768
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Photo #
 Crest Rd./ Hawthorne Blvd. (EB) 56

Keynote 58



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: Bench (16" high seat, 14" deep seat, 15" high back support).	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	E
Level of Difficulty	Moderate

Corrective Action	
027 - Site Work - Miscellaneous - See Additional Comments	
Additional Comments: Provide compliant bench with clear WC seating space.	

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$600
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	
Status	Not Complete As of 05/09/2013
Reported By	

Location: Photo #
 Hawthorne Blvd./ Crest Rd. (NB) 58



City of Rancho Palos Verdes
Rancho Palos Verdes ADA Assessment
Facility Report with Photos



Reporting: 60 of 4367 Rcds

Facility ID: # Area 5 Bus Stops

Author: Vaish, B

Keynote 59



Field Condition	
02.13A - Bus Stop Shelter - Clear Floor Area - Clear floor area of 30" by 48" is not completely within the shelter.	1991 ADAAG 10.2.1(2)
Existing Condition: No WC space provided within the shelter.	2004 ADAAG 810.3
	2007 CBC 1121B.2.1
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	Moderate

Corrective Action
027 - Site Work - Miscellaneous - See Additional Comments
Additional Comments: See Keynote 58 for corrective action.

Costs and Funding	
Qty ...Of:	1 EA
Total Cost	\$0
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Crest Rd. (NB) Photo # 58

Keynote 60



Field Condition	
02.17 - Other - Passenger Loading Zones - See Additional Comments	1991 ADAAG -
Existing Condition: 2.2% to 2.3% CS.	2004 ADAAG -
	2007 CBC -
	Other

Classification	
DOJ Location Type:	1
Use:	PV
Severity:	C
Level of Difficulty	High

Corrective Action
006 - Concrete Walk - Remove non-compliant pavement and replace with new concrete (area as shown on the drawings). The walkway slope shall not exceed 5% along the POT and cross slope shall not exceed 2%.
Additional Comments:

Costs and Funding	
Qty ...Of:	100 SF
Total Cost	\$1,920
Funding Received	\$0
Status Update (check one)	
Completed <input type="checkbox"/> In Progress <input type="checkbox"/> Not Complete <input type="checkbox"/> As of _____ By _____	

Implementation	
Plan Nbr:	DBB
Priority:	
Planned Completion	6/30/2031
Status	Not Complete As of 05/09/2013
Reported By	

Location: Hawthorne Blvd./ Crest Rd. (NB) Photo # 60