

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

TO CROSS STREET. PUSH BUTTON WAIT FOR WALK SIGNAL

Reporting: 150 of 4367 Rcds

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Qty ...Of:

Other 2005 PROWAG-R306 2 -Classification

DOJ Location Type:

Use: PV

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Costs and Funding

1 EA

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

- Implementation

Plan Nbr:

Priority:

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2026

Reported By

Keynote 2

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

2

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2"

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

across in one dimension.

Corrective Action

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2005 PROWAG-R306.3.3 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

WAIT FOR WALK SIGNAL

TO CROSS

STREET, PUSH

BUTTON

Location: Photo # Crestridge Rd. & Crenshaw Blvd.

App: ©2010 BOA Architecture 877-225-4ADA

Page 1 of 75

Printed 2013-05-09



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Keynote

Crestridge Rd. & Crenshaw Blvd.

Location:

Location:

Field Condition

Photo #

Photo #

2

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 4 1 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Crestridge Rd. & Crenshaw Blvd.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

TO CROSS

STREET. PUSH

BUTTON

WAIT FOR WALK

SIGNAL





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds



Location:	Photo #
Crestridge Rd. & Crenshaw Blvd.	2

-Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.4.2

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed

In Progress

Not Complete

As of

Plan Nbr:

- Implementation

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Keynote



Location: Photo #
Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

1 EA

\$0

-Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

| Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

.



Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

TO CROSS STREET. PUSH BUTTON WAIT FOR WALK SIGNAL

Reporting: 150 of 4367 Rcds

Keynote Field Condition

Photo #

2

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 8 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031 Status Not Complete As of 05/09/2013

Βv

DBB

Reported By

- Implementation

Plan Nbr:

Priority:

Keynote

Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

Comments

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Other

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$600

\$0

Reported By

Location: Photo # Crestridge Rd. & Crenshaw Blvd.





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote



Reporting: 150 of 4367 Rcds

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.4% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

Keynote 10

Crestridge Rd. & Crenshaw Blvd.

Location:



Field Condition

Photo #

9

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 2

1 EA

\$2,400

\$0

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion

Status Not Complete As of 05/09/2013

6/30/2026

Reported By

Completed □ In Progress □ Not Complete □ As of

Location: 11

Crestridge Rd. & Crenshaw Blvd.

Photo #

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Status Update (check one)

Βv



Location:

Keynote

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

11

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

DBB

Reported By

Classification

Implementation
Plan Nbr:

Priority:

Crestridge Rd. & Crenshaw Blvd.

12

— Field Condition

Photo #

11

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306.2

1 EA

\$2,400

\$0

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #
Highridge Rd. & Crest Rd. 12

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

of _____ By ___



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

FOR

Reporting: 150 of 4367 Rcds

13

Field Condition

Existing Condition:

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 11 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

- Implementation Plan Nbr:

Priority:

Keynote 14

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

11

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.3.3 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 11 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Plan Nbr:

Priority:

- Implementation

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Reported By

By . Completed □ In Progress □ Not Complete □ As of

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 11

PUSH BUTTON

FOR





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

15

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B 5 1 item 2: 1117B 5 6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 11 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

- Implementation Plan Nbr:

Priority:

Keynote 16

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

11

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 11 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 4 1

1EA

\$0

Classification

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

\$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву



Location: Photo # Crestridge Rd. & Crenshaw Blvd.

11



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote 17



Reporting: 150 of 4367 Rcds

Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 11

-Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Qty ...Of:

Other 2005 PROWAG-R306.4.2

DOJ Location Type: 1

Use: PV
Severity: C

Level of Difficulty Moderate

Costs and Funding _

1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed

In Progress

Not Complete

As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Implementation
Plan Nbr:

Priority:

Keynote 18



Location: Photo #
Highridge Rd. & Crest Rd. 18

-Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 11 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 2

-Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

| Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

By



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

TO CROS STREET PUSH BUTTON WAIT FOR WALK SIGNAL

Reporting: 150 of 4367 Rcds

19

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Βy

Reported By

Keynote 20

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

20

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306.2 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

1 EA

\$2,400

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 20

TO CROS

STREET PUSH

BUTTON WAIT FOR

WALK SIGNAL

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Funding Received \$0

Completed □ In Progress □ Not Complete □ As of

Ву





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote 21

Reporting: 150 of 4367 Rcds



Location: Photo # Highridge Rd. & Crest Rd.

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 5.1% CS & 2.9% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

21

Additional Comments:

Corrective Action

Status Update (check one)

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

30 SF

\$576

\$0

Βv

Keynote 22



Crestridge Rd. & Crenshaw Blvd. 20 Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Existing Condition: 6 LBF.

Corrective Action

2004 ADAAG 309 4

1991 ADAAG 4.27.4

2007 CBC 1117B 6 item 4

Other 2005 PROWAG-R306.3.1:

R405.4

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Classification

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

23

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not

incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

6/30/2031 Status Not Complete As of 05/09/2013

DBB

Reported By

- Implementation

Plan Nbr:

Priority:

Keynote 24

Crestridge Rd. & Crenshaw Blvd.

Location:



Field Condition

Photo #

20

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2005 PROWAG-R306.3.3 Other

1EA

\$0

\$0

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Βv

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Location: Photo #

Crestridge Rd. & Crenshaw Blvd. 20



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Author: Vaish, B

Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Keynote 25

Reporting: 150 of 4367 Rcds



Location: Photo # 20 Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

Reported By

Status Not Complete As of 05/09/2013

Βy

Keynote 26



Location: Photo # Crestridge Rd. & Crenshaw Blvd. 20 Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 4 1 **Classification**

-Classification

- Implementation

Plan Nbr:

Priority:

DOJ Location Type:

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0

Ву



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

TO CROS STREET PUSH BUTTON WAIT FOR WALK SIGNAL

Reporting: 150 of 4367 Rcds

27

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 20 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

Keynote 28

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

20

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

1991 ADAAG -

2004 ADAAG

2007 CBC

2005 PROWAG-R306 3 2 Other

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv

Location: Photo # Highridge Rd. & Crest Rd. 18





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



29

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 2.4% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

6/30/2031

Status Not Complete As of 05/09/2013

Βy

DBB

Reported By

Planned Completion

- Implementation Plan Nbr:

Priority:

Keynote 30

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Photo #

29

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Additional Comments: See Keynote 38 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 **Classification**

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Costs and Funding

039 - Operable Parts - Miscellaneous - See Additional Comments

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Funding Received

Completed □ In Progress □ Not Complete □ As of □

Βv

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 32

App: ©2010 BOA Architecture 877-225-4ADA

Page 15 of 75





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

31

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4.30.4

2004 ADAAG 703.1

2007 CBC 1117B.5.1 item 2; 1117B.5.6

Other 2005 PROWAG-R306.4

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

Implementation
Plan Nbr:

Keynote 32

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Photo #

32

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Implementation

Plan Nbr:

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Reported By

ss □ Not Complete □ As of By

Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 32





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PV

Moderate



Reporting: 150 of 4367 Rcds

33

Corrective Action

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable

part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition: 6 LBF.

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1; Other

1 EA

\$0

R405.4

- Implementation

Level of Difficulty

-Classification

DOJ Location Type:

Plan Nbr: DBB

Priority:

Use:

Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

039 - Operable Parts - Miscellaneous - See Additional Comments

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Additional Comments: See Keynote 38 for corrective action.

Funding Received Status Update (check one)

Costs and Funding

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

Βv

Location: Photo # 32 Crestridge Rd. & Crenshaw Blvd.

Keynote 34



04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306.2

1 EA

\$0

\$0

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

Location: Photo # Crestridge Rd. & Crenshaw Blvd.

32





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

35

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

6/30/2031

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Status Not Complete As of 05/09/2013

Βv

Planned Completion

- Implementation Plan Nbr:

Priority:

Reported By

Location: Photo # 32 Crestridge Rd. & Crenshaw Blvd.

Keynote 36

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: Stable surface is not provided.

1991 ADAAG 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

DBB

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received

Status Update (check one)

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv Completed □ In Progress □ Not Complete □ As of □

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 36



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

37

Field Condition

Corrective Action

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

32

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Βv

Keynote 38

Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 38 for corrective action.

Comments

Existing Condition: Path of travel to pedestrian signal device is not provided.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other

Costs and Funding

Qty ...Of:

Total Cost

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr:

Status Not Complete As of 05/09/2013

DBB

6/30/2026

Reported By

Priority:

Planned Completion

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 36 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

Funding Received \$0

Status Update (check one) Completed □ In Progress □ Not Complete □ As of

1 EA

\$600

Ву





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

DBB

PUSH

Reporting: 150 of 4367 Rcds

39

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** Use: PV Severity:

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2026

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

-Classification

Level of Difficulty

- Implementation Plan Nbr:

Priority:

40 Crestridge Rd. & Crenshaw Blvd.

PUSH BUTTON

Photo #

Keynote 40

Location:

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo # 40

Crestridge Rd. & Crenshaw Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



41

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 9.4% CS & 5% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Keynote

Crestridge Rd. & Crenshaw Blvd.

Location:

42

Photo #

41

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4.30.4

2004 ADAAG 703 1

2007 CBC 1117B 5 1 item 2: 1117B 5 6

Other 2005 PROWAG-R306 4 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Highridge Rd. & Crest Rd.

18

Corrective Action

Additional Comments: See Keynote 18 for corrective action.

039 - Operable Parts - Miscellaneous - See Additional Comments

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv




City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

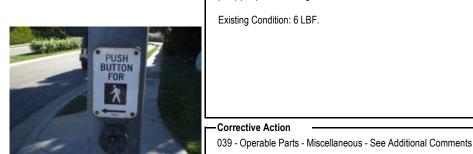

44

PUSH BUTTON

Reporting: 150 of 4367 Rcds

43

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

2005 PROWAG-R306.3.1:

1 EA

2004 ADAAG 309 4

Use: Severity:

-Classification

PV

2007 CBC 1117B 6 item 4

R405.4

Level of Difficulty

DOJ Location Type:

- Implementation

Plan Nbr:

Priority:

Planned Completion

6/30/2031

DBB

Moderate

Status Not Complete As of 05/09/2013

Reported By

Funding Received

Qty ...Of:

Costs and Funding

Other

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Use: Severity:

Crestridge Rd. & Crenshaw Blvd.

Location:

Keynote

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

1991 ADAAG -

Classification DOJ Location Type:

2004 ADAAG -

2007 CBC

Other

PV

Βv

2005 PROWAG-R306 3 2

Level of Difficulty

Moderate

DBB

Photo #

40

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Qty ...Of: **Total Cost**

Costs and Funding

1EA

\$0

\$0

Planned Completion

6/30/2031

Status Not Complete As of 05/09/2013

- Implementation Plan Nbr:

Priority:

Reported By

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 40

Additional Comments: See Keynote 40 for corrective action.

Additional Comments: See Keynote 40 for corrective action.

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

45

—Field Condition

Existing Condition: 1/2" diameter.

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

2004 ADAAG -

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.3.3

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

Corrective Action
039 - Operable Par

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 40 for corrective action.

Costs and Funding ____

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed
In Progress
Not Complete
As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Implementation
Plan Nbr:

Priority:

Location:Photo #Crestridge Rd. & Crenshaw Blvd.40

Keynote 46

Location:

—Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal. **1991 ADAAG** 4.30.4

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2; 1117B.5.6

Other 2005 PROWAG-R306.4

Classification

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

-Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 40 for corrective action.

Costs and Funding

Total Cost

Qty ...Of: 1 EA

Funding Received \$0

Status Update (check one)

Completed
In Progress
Not Complete
As of

\$0

Implementation
Plan Nbr:

Priority:

DBB

 Planned Completion
 6/30/2031

 Status
 Not Complete
 As of 05/09/2013

Ву

Reported By

App: ©2010 BOA Architecture 877-225-4ADA

Crestridge Rd. & Crenshaw Blvd.

Photo #

40

PUSH BUTTON

Page 23 of 75

Printed 2013-05-09





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

47

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 40 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

- Implementation Plan Nbr:

Priority:

40 Crestridge Rd. & Crenshaw Blvd.

PUSH BUTTON

Keynote 48

Location:

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 40 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2005 PROWAG-R306 4 2 Other

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Вν

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 40

Photo #



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

49

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

- Implementation Plan Nbr:

Priority:

Location: Photo # 18 Highridge Rd. & Crest Rd.

Keynote 50

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306.2

1 EA

\$2,400

\$0

Classification

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 51

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

App: ©2010 BOA Architecture 877-225-4ADA

Page 25 of 75

Printed 2013-05-09





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

51



Location:	Photo #
Crestridge Rd. & Crenshaw Blvd.	51

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

Field Condition

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βy

Reported By

Classification

Keynote 52



04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 10.5% CS.

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$4.176

\$0

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of _

Βv



Location: Photo # Crestridge Rd. & Crenshaw Blvd. 52 **Corrective Action**

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments: Relocate curb ramp.

App: ©2010 BOA Architecture 877-225-4ADA

Page 26 of 75





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

53

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

DBB

PV

Moderate

Reported By

Classification

DOJ Location Type:

Level of Difficulty

- Implementation Plan Nbr:

Priority:

Keynote 54

Highridge Rd. & Crest Rd.

Field Condition

Photo #

18

04.32A - Push Button Operating Effort - The force required to activate operable

part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition:

1991 ADAAG 4.27.4

2004 ADAAG 3094

Costs and Funding

Qty ...Of:

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

- Implementation

Plan Nbr: DBB

Priority:

Use: Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Crestridge Rd. & Crenshaw Blvd. 51 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

By .





Location:

Keynote

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

55

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

Classification

- Implementation Plan Nbr:

Priority:

56

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Photo #

51

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

across in one dimension.

Corrective Action

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

2005 PROWAG-R306.3.3 Other

1 EA

\$0

\$0

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

By .

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Location: Photo # Crestridge Rd. & Crenshaw Blvd.

51





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

57

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

Keynote 58

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

51

Photo #

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

Costs and Funding

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 4 1 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Plan Nbr: DBB

Priority:

6/30/2031

Status Not Complete As of 05/09/2013

1 EA

\$0

\$0

- Implementation

Planned Completion

Reported By

Status Update (check one)

Funding Received

Completed □ In Progress □ Not Complete □ As of

Ву



Location: Crestridge Rd. & Crenshaw Blvd. Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

Photo #

51



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

59

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.4.2

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 51 for corrective action.

Costs and Funding -

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

PV

Moderate

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

DOJ Location Type:

Implementation
Plan Nbr:

Priority:

Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 51

Keynote 60

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition: 6 LBF.

1991 ADAAG 4.27.4

2004 ADAAG 309.4

2007 CBC 1117B 6 item 4

Other 2005 PROWAG-R306.3.1;

R405.4

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Use: Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

By .

Reported By

PUSH BUTTON FOR

Location: Photo #
Highridge Rd. & Crest Rd. 18

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 18 for corrective action.

Qty ...Of: 1 EA

Total Cost

Costs and Funding

Funding Received \$0

Status Update (check one)

Completed \Box In Progress \Box Not Complete \Box As of

\$0

of

Printed 2013-05-09



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

61

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Βv

Status Not Complete As of 05/09/2013

Reported By

Keynote 62

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

64

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4.30.4

2004 ADAAG 703 1

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC 1117B.5.1 item 2: 1117B.5.6

Other 2005 PROWAG-R306 4 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Ву

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 64 039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0

Page 31 of 75



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

DBB



Reporting: 150 of 4367 Rcds

63

Field Condition

04.40 - Other - Curb Ramps and Pedestrian Crossings - See Additional Comments

Existing Condition: Path of travel to pedestrian signal device is not provided.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other

-Classification **DOJ Location Type:** Use: PV Severity:

Level of Difficulty

- Implementation Plan Nbr:

Priority:

Corrective Action Costs and Funding 039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Recommendation: Remove pedestrian signal device.

1 EA Qty ...Of:

Total Cost \$600

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2026

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

Location: Photo # 63 Crestridge Rd. & Crenshaw Blvd.

Keynote 64

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.2 Other

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Costs and Funding

Qty ...Of: 1EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

DBB

Reported By

Ву

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 64





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

65

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Keynote 66

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

64

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 10% CS & 5.2% RS.

1991 ADAAG 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

1 EA

\$0

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv

Planned Completion



Location: Photo # Crestridge Rd. & Crenshaw Blvd. 63 Corrective Action

027 - Site Work - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Total Cost

Costs and Funding

Qty ...Of:

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □



Keynote

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PV

Moderate

Reporting: 150 of 4367 Rcds

67

Field Condition

Existing Condition:

Corrective Action

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other

Costs and Funding

Funding Received

Status Update (check one)

Qty ...Of:

Total Cost

1 EA

\$0

Completed □ In Progress □ Not Complete □ As of

2005 PROWAG-R306 3 2

- Implementation

Level of Difficulty

-Classification

DOJ Location Type:

DBB

Priority:

Use:

Severity:

6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Plan Nbr:

Planned Completion

Location: Crestridge Rd. & Crenshaw Blvd.

Photo #

64

68

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 **Classification**

DOJ Location Type:

PV Use: Severity:

Level of Difficulty

Moderate

- Implementation

Plan Nbr: DBB

Priority:

6/30/2031

Status Not Complete As of 05/09/2013

Planned Completion

Reported By By .

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 64 -Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 63 for corrective action.

Costs and Funding

Qty ...Of: 1EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

BUTTON FOR

Reporting: 150 of 4367 Rcds

69

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** Use: PV Severity:

Level of Difficulty - Implementation

Plan Nbr:

Priority:

-Classification

Costs and Funding

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

1 EA Qty ...Of:

Total Cost

Funding Received \$0

Status Update (check one)

Completed \Box In Progress \Box Not Complete \Box As of

\$2,400

Planned Completion 6/30/2026

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

Keynote 70

Highridge Rd. & Crest Rd.

Location:

Field Condition

Photo #

72

72

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:**

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

BUTTON

FOR

Crestridge Rd. & Crenshaw Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Qty ...Of:

Costs and Funding

Total Cost

\$2,400

1 EA

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

71

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

DBB

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one) Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

- Implementation Plan Nbr:

Priority:

Location: Photo # 71 Crestridge Rd. & Crenshaw Blvd.

PUSH

BUTTON

FOR

Keynote 72 Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Ву

Status Not Complete As of 05/09/2013

Reported By

Location: Photo # Highridge Rd. & Crest Rd. 72



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PV

Moderate



Reporting: 150 of 4367 Rcds

73

Field Condition

Existing Condition: 7 LBF.

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B.6 item 4

2005 PROWAG-R306.3.1: Other R405.4

1 EA

\$0

- Implementation

Level of Difficulty

-Classification

DOJ Location Type:

Plan Nbr: DBB

Priority:

Use:

Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Classification

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 71 for corrective action.

Funding Received Status Update (check one)

Costs and Funding

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

Βv

Location: Photo # 71 Crestridge Rd. & Crenshaw Blvd.

Keynote 74



04.32B - Push Button Locator Tone - The pedestrian signal push button does not

incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Funding Received

2007 CBC

2005 PROWAG-R306.3.2 Other

1EA

\$0

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Location: Photo # 71

Crestridge Rd. & Crenshaw Blvd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 71 for corrective action.

Total Cost

Qty ...Of:

\$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Printed 2013-05-09



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

75

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 71 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

- Implementation Plan Nbr:

Priority:

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

Classification

Keynote 76

Crestridge Rd. & Crenshaw Blvd.

Location:



Field Condition

Photo #

71

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 71 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

2007 CBC

Other 2005 PROWAG-R306 4 1 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Funding Received

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0

Ву

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 71



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

Keynote 77



Reporting: 150 of 4367 Rcds

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 71 Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 71 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 4 2 **DOJ Location Type:** Use: PV Severity:

- Implementation

Level of Difficulty

-Classification

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Classification

Funding Received Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Βv

Keynote 78



Location: Photo # Highridge Rd. & Crest Rd. 78 Field Condition

Corrective Action

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 3.1% CS & 5.6% RS.

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$4.176

\$0

DOJ Location Type: PV Use: Severity: Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Additional Comments: Relocate curb ramp.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv





Location:

Location:

Crestridge Rd. & Crenshaw Blvd.

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

79

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 7.7% CS & 2.1% RS.

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

- Implementation Plan Nbr:

Priority:

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2031

Reported By

Classification

Keynote 80

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Photo #

Photo #

81

79

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:**

Severity:

Level of Difficulty Moderate

PV

- Implementation

DBB Plan Nbr:

Priority:

Use:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Funding Received

Completed □ In Progress □ Not Complete □ As of □

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

\$0

Status Update (check one)

App: ©2010 BOA Architecture 877-225-4ADA

Page 40 of 75

Printed 2013-05-09



Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

81

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

- Implementation Plan Nbr:

Priority:

Keynote 82

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Existing Condition:

Photo #

81

72

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

2004 ADAAG -

1991 ADAAG -

2007 CBC

2005 PROWAG-R306.3.2 Other

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Highridge Rd. & Crest Rd.

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 72 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

BUTTON

FOR



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PV

Moderate



Reporting: 150 of 4367 Rcds

83

Field Condition

Existing Condition: 8 LBF.

Corrective Action

04.32A - Push Button Operating Effort - The force required to activate operable part(s) of pedestrian signal device exceeds 5 lbs.

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B.6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

1 EA

\$0

- Implementation

Level of Difficulty

-Classification

DOJ Location Type:

Plan Nbr: DBB

Priority:

Use:

Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Photo #

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Funding Received

Costs and Funding

Qty ...Of:

Total Cost

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Βv

81 Crestridge Rd. & Crenshaw Blvd.

Keynote 84

Location:



04.32B - Push Button Locator Tone - The pedestrian signal push button does not

incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.3.2 Other

\$0

Classification DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

Ву

Status Not Complete As of 05/09/2013

DBB

Reported By

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 81



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

85

Field Condition

Existing Condition: 1/2" diameter.

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2" across in one dimension.

2004 ADAAG -

2007 CBC

1991 ADAAG -

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

DBB

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

- Implementation Plan Nbr:

Priority:

81 Crestridge Rd. & Crenshaw Blvd.

Photo #

Keynote 86

Location:

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG 4.30.4

2004 ADAAG 703 1

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC 1117B 5 1 item 2: 1117B 5 6

2005 PROWAG-R306 4 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

By .

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0

Location: Photo # Crestridge Rd. & Crenshaw Blvd. 81



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Ĭ.

Reporting: 150 of 4367 Rcds

Keynote 87 —Fie

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.4.1

DOJ Location Type: 1

Use: PV
Severity: C

Level of Difficulty Moderate

Implementation
Plan Nbr:

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

Classification

Keynote 88

Crestridge Rd. & Crenshaw Blvd.

Location:

—Field Condition

Photo #

81

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 81 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation

Priority:

Plan Nbr: DBB

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

By .

Reported By

Reporte

Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 81



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

BUTTON FOR

Reporting: 150 of 4367 Rcds

89

Field Condition

Corrective Action

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity:

- Implementation

Plan Nbr: DBB

Level of Difficulty

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Classification

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Βv

72 Highridge Rd. & Crest Rd.

PUSH

Keynote 90

Location:

Field Condition

Photo #

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 72 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306.2

1 EA

\$2,400

\$0

DOJ Location Type:

Use: Severity:

Level of Difficulty Moderate

PV

DBB

- Implementation

Plan Nbr:

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Ву

Location: Photo # Crestridge Rd. & Crenshaw Blvd.

91





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote 91



Reporting: 150 of 4367 Rcds

Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 91

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to indicate the WALK interval

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

-Classification

an Nbr: DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Keynote 92



Location: Photo #
Crestridge Rd. & Crenshaw Blvd. 92

-Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 15.5% CS.

Corrective Action

Additional Comments:

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

30 SF

\$576

-Classification

DOJ Location Type:

Use: PV Severity: C

Level of Difficulty High

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

\$0 Status Not Comple

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

_____ By ____





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

Keynote 93

Reporting: 150 of 4367 Rcds



Location: Photo # 91 Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min., 2" across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Other 2005 PROWAG-R306 3 3 -Classification **DOJ Location Type:** Use: PV Severity:

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Classification

Status Update (check one)

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Βv

Keynote 94



Location: Photo # Crestridge Rd. & Crenshaw Blvd. 91 Field Condition

Corrective Action

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Existing Condition:

1991 ADAAG 4.30.4

Costs and Funding

2004 ADAAG 703 1

2007 CBC 1117B 5 1 item 2: 1117B 5 6

2005 PROWAG-R306 4 Other

DOJ Location Type: PV Use: Severity:

Level of Difficulty

Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Qty ...Of: 1 EA **Total Cost** \$0 **Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031 Status Not Complete As of 05/09/2013

DBB

Reported By





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

95

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

PV

Moderate

Reported By

Classification

DOJ Location Type:

Keynote 96

Crestridge Rd. & Crenshaw Blvd.

Field Condition

Photo #

91

04.32A - Push Button Operating Effort - The force required to activate operable

part(s) of pedestrian signal device exceeds 5 lbs.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Existing Condition: 6 LBF.

Corrective Action

1991 ADAAG 4.27.4

2004 ADAAG 309 4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Use: Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0

Reported By

PUSH

Location: Photo # Crestridge Rd. & Crenshaw Blvd.

91

App: ©2010 BOA Architecture 877-225-4ADA

Page 48 of 75





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote 97



Reporting: 150 of 4367 Rcds

Location: Photo # 91 Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 91 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

Keynote 98



Location: Photo # Highridge Rd. & Crest Rd. 72 Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 72 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG 4.30.4

2004 ADAAG 703 1

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC 1117B 5 1 item 2: 1117B 5 6

Other 2005 PROWAG-R306 4 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty

Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Βv



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

FOR

Reporting: 150 of 4367 Rcds

99

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

Moderate

Status Not Complete As of 05/09/2013

Βv

Reported By

- Implementation Plan Nbr:

Priority:

Location: Photo # 100 Crestridge Rd. & Crenshaw Blvd.

Keynote 100

Location:

Crestridge Rd. & Crenshaw Blvd.

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

indicate the WALK interval

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Funding Received

Other 2005 PROWAG-R306.2

1 EA

\$2,400

\$0

Classification

DOJ Location Type:

PV Use: Severity:

Level of Difficulty

- Implementation

Plan Nbr: DBB

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Priority:

Ву

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

App: ©2010 BOA Architecture 877-225-4ADA

Photo #

100

Page 50 of 75

Printed 2013-05-09





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



101

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 3.4% CS & 11.7% RS

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

30 SF Qty ...Of:

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

Keynote 102

Crestridge Rd. & Crenshaw Blvd.

Location:

Field Condition

Photo #

101

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 4 1 **DOJ Location Type:**

PV Use:

Severity:

Level of Difficulty Moderate

Plan Nbr:

- Implementation

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

DBB

Reported By

Status Update (check one)

1 EA

\$0

Completed □ In Progress □ Not Complete □ As of

Βv

BUTTON

FOR

Location: Photo # Highridge Rd. & Crest Rd. 72 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 72 for corrective action.

App: ©2010 BOA Architecture 877-225-4ADA

Page 51 of 75

Printed 2013-05-09



Keynote

Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

FOR

Reporting: 150 of 4367 Rcds

103

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 100 for corrective action.

incorporate a locator tone at the push button.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Funding Received

Status Update (check one)

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 3 2

1 EA

\$0

Completed □ In Progress □ Not Complete □ As of

-Classification **DOJ Location Type:**

PV

Severity:

Level of Difficulty

- Implementation

Plan Nbr: DBB

Priority:

Use:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

PV

Moderate

Reported By

Classification

DOJ Location Type:

Location: 100 Crestridge Rd. & Crenshaw Blvd.

104

Photo #

Field Condition

04.32A - Push Button Operating Effort - The force required to activate operable

part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition:

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Use: Severity:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 100 for corrective action.

Photo #

Crestridge Rd. & Crenshaw Blvd.

100

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

Reporting: 150 of 4367 Rcds

105

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

Costs and Funding

Funding Received

Status Update (check one)

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 4 1

1 EA

\$0

Completed □ In Progress □ Not Complete □ As of

-Classification **DOJ Location Type:** Use: PV Severity:

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Location:

106

Crestridge Rd. & Crenshaw Blvd.

Keynote

Photo #

100

Field Condition

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 100 for corrective action.

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG -

2007 CBC

2005 PROWAG-R306.3.3 Other

Classification DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Crestridge Rd. & Crenshaw Blvd.

100

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 100 for corrective action.

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0





Location:

Keynote

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

107

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 72 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βy

Status Not Complete As of 05/09/2013

Reported By

Highridge Rd. & Crest Rd.

108

PUSH BUTTON

FOR

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Status Update (check one)

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 2

1 EA

\$2,400

\$0

Completed □ In Progress □ Not Complete □ As of

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

6/30/2026

Ву

Reported By

Planned Completion

Status Not Complete As of 05/09/2013

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Location: Photo # Highridge Rd. & Crest Rd. 109

Photo #

72





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON

Reporting: 150 of 4367 Rcds

109

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

- Implementation Plan Nbr:

Priority:

109 Highridge Rd. & Crest Rd.

Keynote 110

Location:

Field Condition

Photo #

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 5.5% CS & 7.3% RS.

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$576

\$0

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Βv

Location: Photo # Highridge Rd. & Crest Rd. 110 Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Printed 2013-05-09



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Moderate

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

111

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

Costs and Funding

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306 2 **DOJ Location Type:** Use: PV

Level of Difficulty

Severity:

-Classification

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Reported By

Classification

Funding Received Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Βv

Highridge Rd. & Crest Rd.

PUSH BUTTON

FOR

Keynote 112

Location:

Location:



Photo #

Photo #

109

116

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG

Costs and Funding

Qty ...Of:

Total Cost

2007 CBC

2005 PROWAG-R306.3.2 Other

1EA

\$0

DOJ Location Type:

Severity:

Level of Difficulty Moderate

PV

- Implementation

Plan Nbr: DBB

Priority:

Use:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Highridge Rd. & Crest Rd.

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Additional Comments: See Keynote 109 for corrective action.

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

113

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 109 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

- Implementation

Priority:

Planned Completion 6/30/2031

Βy

Status Not Complete As of 05/09/2013

DBB

Reported By

Classification

Keynote 114

Highridge Rd. & Crest Rd.



04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Qty ...Of:

Other 2005 PROWAG-R306 4 1 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

PUSH BUTTON

FOR

Highridge Rd. & Crest Rd.

109

Photo #

109

Corrective Action Costs and Funding

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 109 for corrective action.

Total Cost \$0 **Funding Received** \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON

Reporting: 150 of 4367 Rcds

115

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 109 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

Plan Nbr: Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

Classification

Keynote 116

Highridge Rd. & Crest Rd.

Location:

Field Condition

Photo #

109

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 2 **DOJ Location Type:**

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Highridge Rd. & Crest Rd. 116 -Corrective Action Costs and Funding

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

Вν

PUSH BUTTON





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

FOR

Reporting: 150 of 4367 Rcds

117

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

Status Not Complete As of 05/09/2013

Βv

DBB

6/30/2026

Reported By

- Implementation Plan Nbr:

Priority:

118 Highridge Rd. & Crest Rd.

Keynote 118

Location:

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

039 - Operable Parts - Miscellaneous - See Additional Comments

indicate the WALK interval

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306.2 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$2,400

\$0

Ву



Location: Photo # Highridge Rd. & Crest Rd.

Additional Comments: Replace with vibrotactile signal device.

118

Photo #





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



119

Reporting: 150 of 4367 Rcds



Location: Photo # 119 Highridge Rd. & Crest Rd.

Field Condition

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 7% CS.

Corrective Action

Additional Comments:

1991 ADAAG 424

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty High

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

PV

Reported By

Classification

Status Update (check one)

Funding Received

Costs and Funding

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

30 SF

\$576

\$0

Use:

Βv

Keynote 120



Location: Photo # Highridge Rd. & Crest Rd. 118 Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG

2007 CBC

Total Cost

Funding Received

Other 2005 PROWAG-R306 3 2 **DOJ Location Type:**

Severity:

Level of Difficulty Moderate

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Costs and Funding 039 - Operable Parts - Miscellaneous - See Additional Comments Qty ...Of:

Additional Comments: See Keynote 118 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0

Βv





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

FOR

Reporting: 150 of 4367 Rcds

121

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

2004 ADAAG 703 1

1991 ADAAG 4304

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 118 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation Plan Nbr:

DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

118 Highridge Rd. & Crest Rd.

Keynote 122

Location:

Field Condition

Existing Condition:

Photo #

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 4 1 **DOJ Location Type:**

PV Use: Severity:

Level of Difficulty

Moderate



Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 118 for corrective action.

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Ву

Reported By

Location: Photo # 118

Highridge Rd. & Crest Rd.





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Keynote



123

Location: Photo # 118 Highridge Rd. & Crest Rd.

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 118 for corrective action.

Existing Condition:

Corrective Action

1991 ADAAG -

2004 ADAAG -

2007 CBC

Costs and Funding

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Classification

Status Update (check one)

Funding Received

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Βv

Keynote 124



Highridge Rd. & Crest Rd. 124 Field Condition

Corrective Action

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

008 - Concrete Landing - Remove non-compliant pavement and replace with new

concrete. The landing slope shall not exceed 2% in any direction.

Existing Condition: 3.5% CS & 8.8% RS.

Additional Comments: Relocate curb ramp.

1991 ADAAG 4.2.4

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2004 ADAAG 305.3: Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

30 SF

\$4.176

\$0

DOJ Location Type: PV Use: Severity: Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Βv



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

125

Field Condition

Existing Condition:

Corrective Action

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

DOJ Location Type:

2004 ADAAG -

1991 ADAAG -

Use: PV Severity:

2007 CBC

Costs and Funding

Funding Received

Level of Difficulty

-Classification

Other 2005 PROWAG-R306 3 2

- Implementation

1 EA

\$0

Plan Nbr: DBB

Priority:

Planned Completion

6/30/2031

Moderate

Status Not Complete As of 05/09/2013

Reported By

Classification

Location: Photo # 116 Highridge Rd. & Crest Rd.

Status Update (check one)

Qty ...Of:

Total Cost

Completed □ In Progress □ Not Complete □ As of

Βv

Keynote 126



04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 116 for corrective action.

1991 ADAAG -

2005 PROWAG-R306.2

2004 ADAAG

2007 CBC

Other

Use: Severity:

DOJ Location Type:

Level of Difficulty

- Implementation Plan Nbr:

Priority:

Moderate

DBB

PV

PUSH BUTTON FOR

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Existing Condition: 33.759028,-118.379796

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

6/30/2026

Status Not Complete As of 05/09/2013

Ву

Reported By

Location: 127

Highridge Rd. & Crest Rd.

Photo #





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

127

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2

DOJ Location Type: 1

Use: PV
Severity: C
Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with compliant vibrotactile signal device at compliant location.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$2.400

Funding Received \$

Status Update (check one)

Completed
In Progress
Not Complete
As of

6/30/2031

DBB

·

Status Not Complete As of 05/09/2013

Βy

Reported By

Planned Completion

Implementation
Plan Nbr:

Priority:

Highridge Rd. & Crest Rd. 127

Keynote 128

Location:

—Field Condition

Photo #

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 10.2% CS.

1991 ADAAG 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

Other 2005 PROWAG-R306 2 1

-Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty High

-Corrective Action

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

Qty ...Of: 30 SF

Total Cost \$576

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

Implementation

Plan Nbr:

Priority:

DBB

Planned Completion

ned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

Reported By

Location: Photo #
Highridge Rd. & Crest Rd. 128



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B



Reporting: 150 of 4367 Rcds

129

Field Condition

04.26B1 - Pedestrian Signal Device - Location versus Curbline - Location of pedestrian signal device is not within 5' of curb.

Existing Condition: 7' from curb line.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2.1.1

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 127 for corrective action.

Costs and Funding ____

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

Priority:

- Implementation

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

Highridge Rd. & Crest Rd. 128

Keynote 130

Location:

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

-Corrective Action

1991 ADAAG 4.30.4

2004 ADAAG 703.1

2007 CBC 1117B 5 1 item 2: 1117B 5 6

Other 2005 PROWAG-R306 4

-Classification

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

[Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

PUSH BUTTON

Highridge Rd. & Crest Rd.

Location:

Photo # 116

Photo #

Costs and Funding

039 - Operable Parts - Miscellaneous - See Additional Comments Qty ...Of:

Additional Comments: See Keynote 116 for corrective action.

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

Reported By

As of ______ By ____





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PV

Moderate

DBB

6/30/2031

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

131

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

2004 ADAAG -**Existing Condition:**

2007 CBC

Other 2005 PROWAG-R306 3 2

- Implementation

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 127 for corrective action.

Costs and Funding

1991 ADAAG -

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Βv

Planned Completion

Keynote

Highridge Rd. & Crest Rd.

Location:

132

PUSH BUTTON FOR

Photo #

127

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

Corrective Action

1991 ADAAG 4.30.4

2004 ADAAG 703 1

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC 1117B 5 1 item 2: 1117B 5 6

2005 PROWAG-R306 4 Other

Classification

Reported By

-Classification

Use:

Severity:

Plan Nbr:

Priority:

DOJ Location Type:

Level of Difficulty

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Status Not Complete As of 05/09/2013

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: 127

Highridge Rd. & Crest Rd.

Photo #

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 127 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1EA

\$0

\$0





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

133

Field Condition

Existing Condition:

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

2004 ADAAG -

1991 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 127 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Classification

- Implementation Plan Nbr:

Priority:

127 Highridge Rd. & Crest Rd.

Photo #

Keynote 134

Location:

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

2004 ADAAG

1991 ADAAG -

2007 CBC

2005 PROWAG-R306 4 2 Other

DOJ Location Type: PV Use: Severity:

Level of Difficulty

Moderate

DBB

6/30/2031

- Implementation

Plan Nbr:

Priority:

Planned Completion

Status Not Complete As of 05/09/2013

Reported By

Corrective Action

Existing Condition:

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 127 for corrective action.

Location: Photo # 127

PUSH BUTTON FOR

Highridge Rd. & Crest Rd.

Costs and Funding

Qty ...Of: 1EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

135

Field Condition

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

DBB

Reported By

- Implementation Plan Nbr:

Priority:

Location: Photo # 136 Highridge Rd. & Crest Rd.

Keynote 136

Field Condition

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306.2 **Classification**

DOJ Location Type:

PV Use: Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

1 EA

\$2,400

\$0

Location: Photo # Highridge Rd. & Crest Rd. 136 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with vibrotactile signal device.

Total Cost Funding Received

Qty ...Of:

Costs and Funding

Completed □ In Progress □ Not Complete □ As of



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

137

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Other 2005 PROWAG-R306 4 1 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 116 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

- Implementation Plan Nbr:

116 Highridge Rd. & Crest Rd.

Keynote 138

Location:

Field Condition

Photo #

04.32B - Push Button Locator Tone - The pedestrian signal push button does not

incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

2005 PROWAG-R306.3.2 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 136 for corrective action.

Costs and Funding

Qty ...Of: 1EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

- Implementation

DBB

Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Ву

Location: Photo # Highridge Rd. & Crest Rd. 136





Location:

City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

139

Field Condition

04.33A - Directional Information and Signs - Pedestrian signal device does not provides compliant tactile or visual signs on the face of the device or its housing or mounting to indicate crosswalk direction and the name of the street containing the crosswalk served by the pedestrian signal.

Existing Condition:

1991 ADAAG 4304

2004 ADAAG 703 1

2007 CBC 1117B.5.1 item 2: 1117B.5.6

2005 PROWAG-R306 4 Other

-Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 136 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion

- Implementation Plan Nbr:

Priority:

6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βy

Reported By

Keynote 140

Highridge Rd. & Crest Rd.



Photo #

136

Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 4 1 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Highridge Rd. & Crest Rd. 136 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 136 for corrective action.

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

1 EA

\$0

\$0





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

141

Field Condition

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 136 for corrective action.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

- Implementation

DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βy

Reported By

136 Highridge Rd. & Crest Rd.

Keynote 142

Location:

Field Condition

Photo #

04.24A - Audible Signal Device - A crosswalk with pedestrian signal indication does not have an audible signal device to indicate the WALK interval.

Existing Condition:

1991 ADAAG -

2004 ADAAG

2007 CBC

Costs and Funding

Qty ...Of:

Total Cost

Other 2005 PROWAG-R306 2 **Classification**

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2026

Status Not Complete As of 05/09/2013

Status Update (check one)

1 EA

\$2,400

Reported By

Location: Photo # Highridge Rd. & Crest Rd. 143 Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Provide audible signal device.

Funding Received \$0

Completed □ In Progress □ Not Complete □ As of





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

143

Field Condition

Existing Condition:

04.24B - Vibrotactile Signal Device - A crosswalk with pedestrian signal indication does not have a vibrotactile signal device integrated into the signal device to

indicate the WALK interval

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: Replace with compliant vibrotactile signal device at compliant location.

Costs and Funding

1 EA Qty ...Of:

Total Cost \$2,400

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr: Priority:

- Implementation

Planned Completion 6/30/2031

Βy

Status Not Complete As of 05/09/2013

DBB

Reported By

Highridge Rd. & Crest Rd.

Keynote 144

Location:

Field Condition

Photo #

143

04.25 - Pedestrian Signal Device - Clear Floor Space - Location of pedestrian signal device does not accommodate a level 30" x 48" min.. clear space, centered and parallel to the pedestrian signal push button. (Accessible pedestrian signals shall be located so that the vibrotactile feature can be contacted from the level landing serving a curb ramp, if provided, or from a clear floor or ground space that is in line with the crosswalk line adjacent to the vehicle stop line.)

Existing Condition: 4.5% CS.

1991 ADAAG 4.2.4

2004 ADAAG 305.3; Fig. 305.3

2007 CBC 1118B 4 item 1

2005 PROWAG-R306 2 1 Other

Classification

DOJ Location Type:

PV Use:

Severity:

Level of Difficulty Hiah

- Implementation

DBB Plan Nbr:

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

Location: Photo #

Highridge Rd. & Crest Rd. 144 **Corrective Action**

008 - Concrete Landing - Remove non-compliant pavement and replace with new concrete. The landing slope shall not exceed 2% in any direction.

Additional Comments:

Costs and Funding

Total Cost

Qty ...Of: 30 SF

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of □

\$576

Βv



City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

145

Field Condition

04.26B1 - Pedestrian Signal Device - Location versus Curbline - Location of pedestrian signal device is not within 5' of curb.

Existing Condition: 6' from curb line.

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.2.1.1

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 143 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation
Plan Nbr:

Nbr: DBB

Priority:

Planned Completion 6/30/2031

Βv

Status Not Complete As of 05/09/2013

Reported By

Classification

Keynote 146

Highridge Rd. & Crest Rd.

Location:



—Field Condition

Photo #

144

04.33C - Street Name - Pedestrian signal device does not includes street name information consisting of California Grade 2 Braille and aligned parallel to the crosswalk direction. OR Pedestrian signal device does not provide street name information in audible format. (Street name information in one format or the other is required to be compliant.)

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 4 2

DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

-Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 116 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Implementation

Plan Nbr: DBB

Priority:

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Reported By

f By

Location: Photo #
Highridge Rd. & Crest Rd. 116





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

Reporting: 150 of 4367 Rcds

147

Field Condition

04.32B - Push Button Locator Tone - The pedestrian signal push button does not incorporate a locator tone at the push button.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306 3 2 -Classification **DOJ Location Type:** Use: PV Severity: Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 143 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Planned Completion 6/30/2031

Status Not Complete As of 05/09/2013

Βv

DBB

PV

Moderate

6/30/2031

 
Reported By

Classification

DOJ Location Type:

- Implementation Plan Nbr:

Priority:



Highridge Rd. & Crest Rd.

Location:

Location:



04.32A - Push Button Operating Effort - The force required to activate operable

part(s) of pedestrian signal device exceeds 5 lbs.

Existing Condition:

Corrective Action

1991 ADAAG 4.27.4

2004 ADAAG 309 4

2007 CBC 1117B 6 item 4

2005 PROWAG-R306.3.1: Other

R405.4

- Implementation

Level of Difficulty

Plan Nbr: DBB

Priority:

Use: Severity:

Planned Completion

Status Not Complete As of 05/09/2013

Ву

Reported By

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 143 for corrective action.

Photo # 143

Photo #

143

Highridge Rd. & Crest Rd.

Costs and Funding

Funding Received

Qty ...Of: 1 EA

Total Cost \$0

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

\$0

Printed 2013-05-09





City of Rancho Palos Verdes Rancho Palos Verdes ADA Assessment



Facility Report with Photos

Facility ID: # Area 4 Pedestrian Signals

Author: Vaish, B

PUSH BUTTON FOR

Reporting: 150 of 4367 Rcds

149

—Field Condition

04.33B - Arrow - Pedestrian signal device does not includes a tactile arrow that contrasts with the background and is aligned parallel to the crosswalk direction.

Existing Condition:

1991 ADAAG -

2004 ADAAG -

2007 CBC

Other 2005 PROWAG-R306.4.1

DOJ Location Type: 1

Use: PV

Severity: C

Level of Difficulty Moderate

Corrective Action

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 143 for corrective action.

Costs and Funding

Qty ...Of: 1 EA

Total Cost \$0

Funding Received \$6

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Plan Nbr:

- Implementation

Priority:

Planned Completion 6/30/2031

DBB

Status Not Complete As of 05/09/2013

Βv

Reported By

Keynote 150

Highridge Rd. & Crest Rd.

Location:



Field Condition

Corrective Action

Photo #

143

04.32C - Push Button Size - The pedestrian signal push button is not a min.. 2"

039 - Operable Parts - Miscellaneous - See Additional Comments

Additional Comments: See Keynote 143 for corrective action.

across in one dimension.

Existing Condition: 1/2" diameter.

1991 ADAAG -

2004 ADAAG

Costs and Funding

Funding Received

Qty ...Of:

Total Cost

2007 CBC

Other 2005 PROWAG-R306.3.3

1EA

\$0

\$0

-Classification –
DOJ Location Type:

Use: PV

Severity: C

Level of Difficulty Moderate

- Implementation

Plan Nbr: DBB

Priority:

Planned Completion

Status Not Complete As of 05/09/2013

Reported By

Status Update (check one)

Completed □ In Progress □ Not Complete □ As of

Reported By

Ву

Location: Photo #
Highridge Rd. & Crest Rd. 143

6/30/2031