

**Portuguese Bend Land Movement Monitoring Survey**  
October 10, 2023 (M38) through August 1, 2024 (M44)  
**Survey Report**  
for the  
**City of Rancho Palos Verdes**  
prepared by  
**McGee Surveying Consulting**

Portuguese Bend is typically monitored for land movement on a tri-annual basis with an initial survey of all current monitoring points at the beginning of the rainy season in the fall of each year followed by two subsequent Partial Winter and Partial Spring Monitoring Surveys of 30-40 points. In past years, the survey report was published following the spring survey; however, at the City's request, due to the excessive land movement, the surveys have been conducted every six weeks and now every month as listed below. The surveys are reported as Addendums with appropriate edits herein and the movement results included in the attached "PB MOVEMENT DATA POSTING .....xlsx" made available usually within five days of completion of the field survey. Movements are reported for the average date of the survey noted below and listed hereafter.


M38 Full Survey - October 10, 2023  
M39 Full Survey - January 13, 2024  
M40 Partial Survey - March 8, 2024  
M41 Partial Survey - April 17, 2024  
M42 Full Survey - May 28, 2024  
M44 Full Survey - August 1, 2024

SPREADSHEET ATTACHMENT: "PB MOVEMENT DATA POSTING M44 - 2007 to August 1, 2024.xlsx"

## **OVERVIEW:**

McGee Surveying Consulting (MSC) performed the 2023-2024 land movement monitoring surveys at Portuguese Bend. The surveys were planned, coordinated, and executed by Michael McGee, PLS3945 of MSC who is responsible for the field surveys, processing observations, network adjustments, analysis, and reports. For a general history, details and procedures utilized in this survey but not re-stated here, see the “Portuguese Bend Land Movement 2020-2021 Monitoring Survey” report dated October 5, 2021, revised and published May 11, 2022. See also prior reports.

## GNSS MONITORING NETWORK (M38)

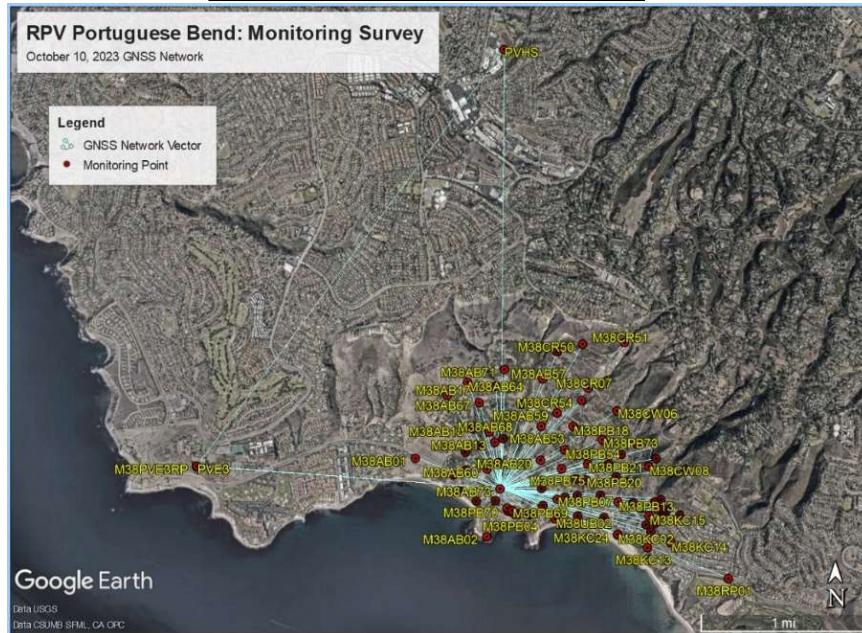

This Initial October 10, 2023 Survey determined the precise positions of 79 monitoring and control points. PVE3 and other CSRC CGPS (CGNSS) stations were used to support and reference the survey network and verify the recovery of the reference frame. This survey included two new points set in July 2023 for the M37 Survey in Klondike Canyon (Seaview) and ten new points set in September 2023. Additional points have been set on most subsequent surveys as necessary and noted in the addendums. Point KC02 was replaced by KC24 in the October in anticipation of its future destruction. Point AB21 was recovered from the 2007 survey and substituted for nearby AB20 (destroyed by others) and will facilitate continuous monitoring at this location.

**McGEE SURVEYING CONSULTING**  
5290 Overpass Road, Ste#107, Santa Barbara, CA 93111

The movements of new points are included in this Report as an Addendums. All monitoring survey coordinates and movements to date are listed in the spreadsheet “PB MOVEMENT DATA POSTING 2007-[present].xlsx” noted above as attached to this Report.

#### **PROJECT DATUMS - REFERENCE FRAME**

The horizontal and vertical positions of the monitoring points are based on the North American Datum of 1983 (NAD83) Epoch 2007.00 and the North American Vertical Datum of 1988 (NAVD 88) reference frames. Although more current epoch adjustments are available (e.g. NAD83 (2011) Epoch 2010.00), Epoch 2007.00 is retained to maintain consistently relative positions over time. Orthometric heights (NAVD88 Elevations) are based on measured ellipsoid heights combined with the NGS Geoid03 model and referenced to NGS Benchmarks. Although more current geoid models (e.g. Geoid18), are available, Geoid03 is retained to maintain consistently relative height movements over time as explained in said May 2022 Report. The latitudes and longitudes determined by GNSS measurements are converted to grid coordinates by projected onto NAD83 California State Plane Coordinates Zone 5 in US Survey Feet.

A valid recovery of the survey reference frame is essential to accurately measure and assess actual movements of individual points relative to the greater peninsula. The method for recovering the monitoring survey reference frame was modified in 2019 to improve the efficiency and simplify the processing and analysis of the monitoring surveys. Since 2007, Point AB02 (at the south end of Portuguese Point) has proven to be stable relative to PVE3 which is a California Spatial Reference Center (CSRC) Continuously Operated GPS Station (CGPS) at City Hall. The present procedure fixes PVE3RP (a PK Nail set on the concrete base of PVE3 as a reference mark to PVE3) and checking to point AB02. The proven positions relative to PVE3 are listed below.

| Pt#    | Latitude       | Longitude       | NAVD88 Ht | Source)                                |
|--------|----------------|-----------------|-----------|--|
| AB02   | 33-44-13.84878 | 118-22-26.19243 | 116.47 ft | 2007 - October 2018 position           |
| PVE3RP | 33-44-35.74239 | 118-24-15.27451 | 346.88 ft | Average of 5 years referencing to PVE3 |

Comparing the positions of AB02 on Portuguese Point with PVE3RP at City Hall and other CSRC CGPS Stations provides a redundant verification that the reference frame is stable and successfully recovered for each monitoring survey. An additional stable check point “RP01” was established near the entrance to the Trump Golf Course for incorporation in future surveys.

The rate of movement (velocities) of the land masses have increased over the past five years compared to the previous 12-year average. See “Assessment of Movements & Accelerations” addressed on Page 11. Notwithstanding the 2019 monitoring process noted above, the processing of observations was necessarily modified for this fall survey because of the higher velocities as follows.

The October 2023 observations were processed as follows. The Base Station at AB73 was occupied over a six-day period and was found to have moved about 0.016 feet per day similar to other monitoring points in the area. To determine accurate positions and therefore precision movements it was necessary to determine a daily position of AB73. This was accomplished by processing the static data collected each day at AB73 with static data downloaded from the CSRC for CGPS stations PVE3 and PVHS. PVE3 is and has always been the basic constraint for the monitoring survey’s reference frame. PVHS was used to verify the stability of PVE3. Subsequently positions of AB73 were computed for each day referenced to PVE3. The identity for processing the daily observations of AB73 and related RTK measurements was to assign to AB73 the identity of AB731, AB732, AB733, AB734 & AB735 for days 1 through 5 occurring on October 8, 9, 10, 11 & 13.


#### **BASE STATIONS – POINT NAMES**

AB61 and AB20 have previously served as suitable GNSS Base Stations for referencing measured positions of the monitoring points. AB61 is no longer accessed due to its environmental sensitivity and lack of security. AB73, located on the US Pony Club property was utilized as the Base Station up to the October 2023 survey. Access was obtained unilaterally by MSC from the Pony Club manager for exclusive permission to enter the property confirmed prior to each survey entry with the understanding that 5 mph driving protocols are observed. Point AB73 was not a planned monitoring point but given the increased rates of movement, it fills in a gap between AB20 and AB50 and moves consistent with AB20. AB50 and AB73 are on the south and north sides of

PVDS respectively. The separation between AB73 and AB50 is diminishing at the rate of about one foot per month in April 2024 resulting in a steeper slope on the north side of PVDS which may be de-stabilizing.

Due to the continuously increasing velocities of land movement, the present on-site base stations (AB20 and AB73) are no longer stable for measuring relative movements. In the January 2024 survey the Smartnet RTN network utilizing remote base stations connected by the Internet was used to measure positions and vectors which were re-referenced to PVE3RP and PVE3 in a network least squares adjustment. Surveys subsequent to the January survey are referenced to a new base station monument “RP02” set about 1400 feet northerly of the entrance to Abalone Cove Park and ¼ mile westerly of the present active slide boundary. See discussion hereafter.

### October 2023 GNSS Survey Monitoring Points Network

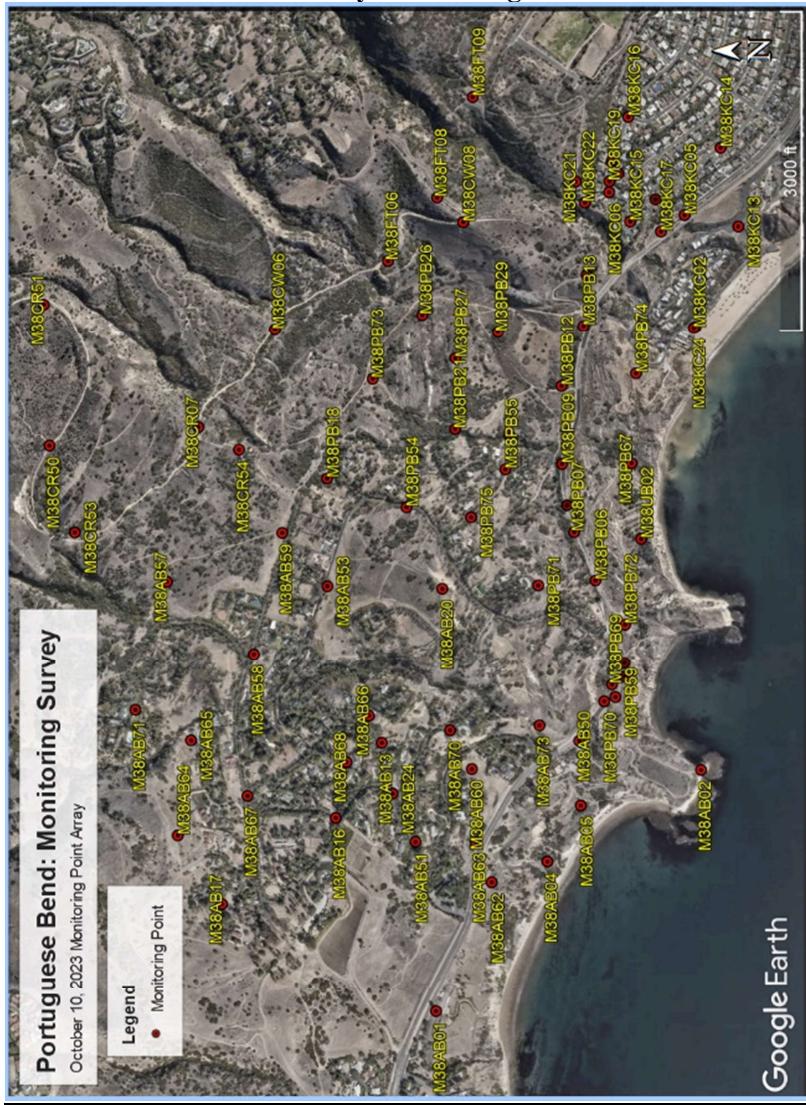

The monitoring points names were established in the early surveys. The points are named for the slide they fall within and given a number. For example, AB01, PB01, KC01, CR01 and FT01. The number is increased as new points are established to replace abandoned or destroyed points or expand the network. Many of the original points are lost or no longer monitored. For data management purposes the point names are also prefixed with a sequential monitoring number to distinguish subsequent surveys. For example, for the occupation of AB02 on the 16<sup>th</sup> monitoring survey, AB02 is called M16AB02 where M16 indicates the sequence number since the first Monitoring Survey “M01” in September 2007. The prefix is stripped in these Reports.

**McGEE SURVEYING CONSULTING**  
5290 Overpass Road, Ste#107, Santa Barbara, CA 93111

**GNSS October 2023 M38 Survey Parameters, Metadata & Equipment**

**Date of Annual Initial Survey:** M38 – October 10, 2023 (mean date) between 0800-1700 PDST (+7 hrs for UTC).

**Constellations:** GPS (31 Satellites), Russian GLONASS (23 Satellites), Galileo (23 Satellites) and Beidou (40 Satellites).

**Observables (Carrier Waves):** GPS (L1, L2, L5), GLONASS (L1, L2), Beidou (L1, L2); & Galileo (4 Carrier Waves)

**Data Epoch Rate** - 0.2 seconds (20HZ) at the GS18 Rover; 1 second at the GS18 Base

**Satellites:** 20-40; **GDOP:** < 2; **Elevation Mask:** 0° at the Rover and Base Station

**Ephemeris:** Broadcast for RTK vectors.

**Weather:** Mostly calm clear skies, temperature 65-75° F, no significant weather.

**Space Weather:** Boulder K Index 1-3 averaging 2 (gauges ionospheric activity on a scale of 0-9; less than 6 preferred)

**Equipment:** GNSS Base Receiver Unit No. M11, Operator: M. McGee, PLS; Occupied Base Station

    Receiver Make & Model: Leica GS18 with integrated Antenna; Mount: Tripod & Tribrach

    GNSS Rover Receiver Unit No. M10, Operator: M. McGee, PLS

    Receiver Make & Model: Leica GS18T with integrated Antenna; Mount: Fixed Height Pole #4

**Processing & Adjustments:** Leica Infinity v4.0 and "Starnet-PRO" version 11.0.6 Software

Prior to 2019, geodetic grade GNSS receivers collected static satellite signal data for post processing. The instrumentation was upgraded in 2020 to a Leica GS18 Base with a GS18T RTK Rover operating in real-time with an FM radio system which utilizes the latest technology to deliver increased productivity and precision of point positions. The GS18 receiver incorporates an Inertial Measurement Unit and tracks four Global Navigation Satellite Systems (GNSS): GPS, GLONASS, Galileo and Beidou Satellites. The differences in two measured vectors are acceptable if they fall within 0.03 feet (1 cm) horizontally; otherwise, additional measurements are usually obtained with some exceptions. Experience has shown the independent measurements generally agree on average about 0.02 feet when referenced to a local base receiver.

**ADJUSTMENTS & ANALYSIS**

**Network Adjustment:** A minimally constrained adjustment is utilized to develop NAD83 (2007) 2007.00

Epoch Zone 5 State Plane Coordinates and NAVD88 Heights of the monitoring points. The NAVD88 orthometric heights (elevations) are determined by combining the measured ellipsoid heights with the Geoid 03 Model. Previously, Point AB02 was fixed, and the stability verified relative to PVE3RP which is 1.5 to 3 miles westerly and outside the influence of the land movements. AB02 is expected to be stable and unaffected by the land movement; however, due to the substantially increased rates of movement resulting in dynamically differential movements the process was modified as noted above to assure accurate positions. This was accomplished by computing daily positions on the Base Station AB73 (AB731, AB732, AB733, AB734, AB735) relative to the reference frame fixed at station PVE3 noted above. Listed here are the differences.

| ID     | Differences in Feet |        |        |  |
|--------|---------------------|--------|--------|--|
|        | dN                  | dE     | dZ     |  |
| PVE3   | 0.000               | 0.000  |        | Fixed Horizontal, CGPS Station at City Hall            |
| AB02   | -0.022              | -0.008 | 0.000  | Fixed Elevation & Horizontal Check                     |
| PVE3RP | -0.010              | -0.003 | -0.055 | Closure Check from PVE3 to AB73 to PVE3RP at City Hall |
| PVHS   | -0.035              | 0.003  |        | Horizontal Check on CGPS Station 2 Miles North of PB   |

**Comments:** Fixing the CGPS station PVE3 (fixed constraint since 2007) finds the differences at PVHS, PVE3RP and AB02 are insignificant measurement noise. Given that AB02, PVE3RP, PVE3 and PVHS are in good relative agreement, the survey reference frame is deemed stable and successfully recovered from which local land movements were determined.

**ACCURACY STATEMENTS**

**Vector Residuals:** In this Initial Survey, the two-dimensional vector residuals averaged 0.012 feet and the absolute value of the vertical residuals averaged 0.02 feet as listed below. The vector residuals are based on a network adjustment of independent point positions.

| Vector Lengths (ft) |         | Two Dimensional Residuals |          |         | Absolute Vertical Residuals |          |                |
|---------------------|---------|---------------------------|----------|---------|-----------------------------|----------|----------------|
| Vary                | Average | Average                   | Std.Dev. | Maximum | Average                     | Std.Dev. | Range          |
| 131-16391           | 3792    | 0.012                     | 0.006    | 0.029   | 0.02                        | 0.02     | -0.03 to +0.08 |

**Movement Accuracy:** A point is deemed to have moved if, at the 95% level of confidence the horizontal movement (signal) of a point between two epochs is greater than the 95% Error (noise). Based on multiple independent occupations, the horizontal (2D) movements reported between October 2022 (M34) and October 2023 (M38) statistically attained a relative average accuracy of 0.014 feet at the 95% Level of Confidence with a Standard Deviation of 0.004 feet and a Range of 0.01 to 0.03 feet. See the attached file “PB MOVEMENT DATA POSTING .....xlsx” for movements and coordinates.

**Table of 2D & Vertical Movements for 12.0 Months October 10, 2022 (M34) & October 10, 2023 (M38)**

Listed below are the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See the attached spreadsheet “PB MOVEMENT DATA POSTING.....xlsx”. Note: The horizontal measured movement confidence is estimated at +/- 0.02' (1/4"); therefore, movements of less than 0.03' are statistically indeterminate. The estimated vertical measured movement confidence is +/- 0.05'.

\* = Control Point for Recovery of the Reference Frame.

| Point ID | Azimuth° | Horizontal Movement | Vertical Movement | Point ID | Azimuth° | Horizontal Movement | Vertical Movement |
|----------|----------|---------------------|-------------------|----------|----------|---------------------|-------------------|
| AB01     | 244      | 0.06                | 0.0               | KC02     | 196      | 1.99                | 0.1               |
| AB02     | 201      | 0.02                | 0.0               | KC05     | 219      | 0.88                | -0.1              |
| AB04     | 223      | 4.80                | -0.6              | KC06     | 253      | 1.34                | -0.5              |
| AB05     | 231      | 3.51                | -0.6              | KC07     | 256      | 0.02                | 0.0               |
| AB13     | 198      | 2.48                | -0.6              | KC13     | 193      | 0.70                | 0.1               |
| AB16     | 191      | 1.20                | 0.0               | KC14     | 259      | 0.12                | -0.1              |
| AB17     | 187      | 0.06                | 0.0               | KC15     | 233      | 1.36                | -0.4              |
| AB20     | 199      | 3.06                | -0.1              | KC16     | 251      | 0.03                | 0.0               |
| AB24     | 198      | 2.68                | 0.0               | KC17     | 222      | 1.24                | -0.3              |
| AB50     | 236      | 1.99                | 0.2               | KC18     | 202      | 2.86                | -0.3              |
| AB51     | 202      | 2.05                | -0.2              | PB04     | 203      | 3.62                | -0.3              |
| AB53     | 192      | 2.75                | -0.4              | PB06     | 200      | 3.35                | -0.3              |
| AB57     | 169      | 2.37                | -0.7              | PB07     | 201      | 3.85                | -0.1              |
| AB58     | 183      | 2.22                | -0.4              | PB08     | 201      | 3.61                | 0.0               |
| AB59     | 186      | 3.17                | -0.8              | PB09     | 198      | 3.49                | -0.1              |
| AB60     | 204      | 2.69                | -0.3              | PB12     | 200      | 4.67                | -0.3              |
| AB62     | 203      | 3.73                | -0.4              | PB13     | 201      | 3.83                | 0.1               |
| AB63     | 207      | 3.58                | -0.9              | PB18     | 187      | 3.51                | -0.5              |
| AB64     | 155      | 0.35                | -0.1              | PB20     | 199      | 4.23                | -0.4              |
| AB65     | 167      | 1.49                | -0.3              | PB21     | 195      | 3.93                | -0.6              |
| AB66     | 196      | 2.29                | -0.5              | PB26     | 192      | 3.94                | -0.4              |
| AB67     | 180      | 1.12                | -0.2              | PB27     | 195      | 4.18                | -0.8              |
| AB68     | 193      | 2.03                | -0.6              | PB29     | 200      | 4.02                | -1.0              |
| AB70     | 203      | 2.97                | -0.1              | PB54     | 196      | 3.39                | -0.2              |
| AB71     | 158      | 1.76                | -0.6              | PB55     | 199      | 3.86                | -0.8              |
| AB73     | 203      | 3.00                | -0.3              | PB59     | 199      | 4.11                | -0.6              |
| CR07     | 171      | 1.87                | -1.6              | PB67     | 194      | 5.93                | -0.8              |
| CR50     | 225      | 0.11                | -0.1              | PB68     | 202      | 3.49                | -0.1              |
| CR51     | 223      | 0.08                | 0.0               | PB69     | 202      | 3.91                | -0.3              |
| CR53     | 231      | 0.21                | 0.0               | PB70     | 207      | 3.58                | -0.8              |
| FT06     | 192      | 3.66                | -1.7              | PB71     | 198      | 3.65                | -0.4              |
| FT08     | 257      | 0.06                | 0.0               | UB02     | 189      | 4.17                | 0.3               |
| FT09     | 271      | 0.08                | -0.1              | *PVE3RP  | 195      | 0.01                | 0.0               |

**October 10, 2022 to October 10, 2023 Movement Distances (Feet) & Directions as Indicated**


*Note: Distances are exaggerated x 100 for viewing*



## Enlargement (PVDS)



## Enlargement (Seaview)

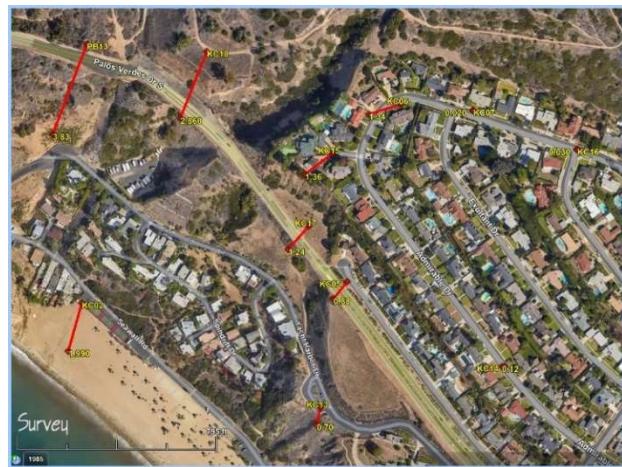

## **MONITORING POINT MONUMENT NOTES & STATUS**

See the May 2022 Survey Report for prior monument notes.

2023: 16 points added to the monitoring program as listed below. AB20 destroyed after October 2023 Survey and replaced by AB21.

## **MONITORING POINT MONUMENT DESCRIPTIONS**

All other Point Descriptions are listed in prior Reports.

California State Plane Coordinates Zone 5 in the NAD83 (2007) Epoch 2007.00 and NAVD88 Datums are listed in the attached spreadsheet file "PB MOVEMENT DATA POSTING....".

### Point Description

Points added in July and October 2023

|      |  |
|------|--|
| AB21 | 2" Punched GIP in "Cable Box", Replaced AB20 after Oct. 2023 survey  |
| PB72 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| PB73 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| PB74 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| PB75 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| CR54 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| CW05 | Found ½" x 48" Punched Rebar in Concrete Collar set June 2022 for CalWater   |
| CW06 | Found ½" x 48" Punched Rebar in Concrete Collar set June 2022 for CalWater   |
| CW07 | Found ½" x 48" Punched Rebar in Concrete Collar set June 2022 for CalWater   |
| CW08 | Found 2" Mag nail in Concrete Base of 3' Bollard set June 2022 for CalWater  |
| KC19 | 2" Mag Nail Drilled in a Concrete Curb on South side of Dauntless Dr.  |
| KC20 | 2" Mag Nail Drilled in a Concrete Curb on West side of Excelsior Dr.   |
| KC21 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| KC22 | 2" mag nail & washer in conc. in 2"x 24" GIP Collared in Concrete  |
| KC23 | 2" Mag Nail Drilled in a Concrete Curb on South side of Admirable Dr.  |
| KC24 | 2" Mag Nail Drilled in the Southwest Corner of a Concrete Vault, KC02 planned replacement  |
| RP01 | Check Point at Trump Golf Course established in July 2023 for verifying the recovery of a stable reference frame. Point is the top open part of the "B" on the south side of the rim of a manhole on the south side of PVDS at Conqueror Dr. |

## **Addendum No. 1 Report**

### **Portuguese Bend Land Movement Monitoring Survey** **Early Winter Full Monitoring Survey No. M39 - January 13, 2024**

A special Portuguese Bend Full Monitoring Surveys (M39) was requested by the City in January 2024. The average date of the survey is January 13, 2024, 3.1 months after the October 10, 2023 Initial Monitoring for 2023-2024 reported above. The M39 survey included 79 monitoring points representing the present full network. A central base station (usually occupying AB73) was not feasible due to the excessive rate of land movement and reliance was made on the remote Smartnet RTN Stations which resulted in a lesser accuracy. For this survey, this was not an issue since the signal (measured movement) was much greater than the noise of the measurements expected to be less than 0.05'. A typical minimally constrained adjustment, as described above for M38, was processed for M39 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights.

The horizontal (2D) vector residuals averaged 0.03 feet with a Standard Deviation of 0.02 feet. The absolute value of the vertical residuals averaged 0.04 feet with a Standard Deviation of 0.04 feet. At the 95% Level of Confidence, estimated accuracy of the horizontal (2D) movements is 0.05 feet.

The adjustment fixed point PVE3RP (an indirect fix on PVE3) and checked to other points found to be stable. Differences from the known fixed positions to the measured positions in this survey are listed here with their north, east and vertical components in feet. The successful recovery of a stable reference frame (coordinate system) is confirmed.

| ID     | Differences in Feet |      |                                  |
|--------|---------------------|------|----------------------------------|
|        | dN                  | dE   | dZ                               |
| PVE3RP | 0.00                | 0.00 | 0.00                             |
| AB02   | 0.01                | 0.01 | -0.05                            |
| RP01   | -0.01               | 0.01 | 0.05                             |
|        |                     |      | Fixed Reference at City Hall     |
|        |                     |      | Check Point at Portuguese Point  |
|        |                     |      | Check Point at Trump Golf Course |


**Table of 2D & Vertical Movements for 3.1 Months October 10, 2023 (M38) & January 13, 2024 (M39)**

Listed below are the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See the attached spreadsheet “PB MOVEMENT DATA POSTING (Revised 012224) 2007-Jan2024.xlsx”. Note: The horizontal measured movement confidence is estimated at +/-0.04’ (1/2”); therefore, indicated movements of less than 0.05’ are statistically indeterminate. The estimated vertical measured movement confidence is +/-0.08’.  
\* = Control Point for Recovery of the Reference Frame.

| Point ID | Azimuth° | Horizontal Movement | Vertical Movement | Point ID | Azimuth° | Horizontal Movement | Vertical Movement |
|----------|----------|---------------------|-------------------|----------|----------|---------------------|-------------------|
| AB01     | 23       | 0.01                | -0.1              | KC13     | 188      | 0.44                | 0.0               |
| AB02     | 27       | 0.01                | 0.0               | KC14     | 262      | 0.03                | 0.0               |
| AB04     | 223      | 3.52                | -0.4              | KC15     | 233      | 0.91                | -0.3              |
| AB05     | 230      | 2.76                | -0.4              | KC16     | 88       | 0.02                | 0.0               |
| AB13     | 195      | 2.44                | -0.4              | KC17     | 218      | 0.80                | -0.3              |
| AB16     | 190      | 1.71                | -0.1              | KC18     | 200      | 2.03                | -0.3              |
| AB17     | 118      | 0.03                | 0.0               | KC19     | 269      | 0.74                | -0.2              |
| AB21     | 197      | 2.80                | 0.1               | KC20     | 277      | 0.67                | -0.2              |
| AB24     | 195      | 2.71                | 0.0               | KC21     | 92       | 0.04                | 0.0               |
| AB50     | 234      | 1.63                | 0.0               | KC22     | 255      | 1.07                | -0.5              |
| AB51     | 200      | 2.08                | 0.0               | KC23     | 237      | 0.57                | -0.3              |
| AB53     | 190      | 2.79                | -0.3              | KC24     | 199      | 1.22                | -0.1              |
| AB57     | 170      | 1.77                | -0.5              | PB04     | 202      | 2.63                | 0.0               |
| AB58     | 179      | 2.50                | -0.4              | PB06     | 200      | 2.43                | -0.2              |
| AB59     | 185      | 3.11                | -0.8              | PB07     | 201      | 2.62                | 0.0               |
| AB60     | 204      | 2.54                | -0.2              | PB08     | 201      | 2.60                | 0.0               |
| AB62     | 203      | 2.62                | -0.3              | PB09     | 197      | 2.40                | -0.1              |
| AB63     | 207      | 2.79                | -0.8              | PB12     | 199      | 3.16                | -0.3              |
| AB64     | 128      | 0.19                | 0.0               | PB13     | 199      | 2.51                | 0.0               |
| AB65     | 167      | 1.98                | -0.6              | PB18     | 185      | 2.94                | -0.5              |
| AB66     | 193      | 2.41                | -0.4              | PB20     | 198      | 2.82                | -0.3              |
| AB67     | 181      | 1.56                | -0.3              | PB21     | 194      | 2.66                | -0.5              |
| AB68     | 191      | 2.28                | -0.4              | PB26     | 193      | 2.65                | -0.2              |
| AB70     | 200      | 2.85                | -0.2              | PB27     | 196      | 2.75                | -0.5              |
| AB71     | 158      | 1.35                | -0.4              | PB29     | 200      | 2.60                | -0.7              |
| AB73     | 202      | 2.52                | -0.1              | PB54     | 192      | 2.90                | 0.0               |
| CR07     | 164      | 1.47                | -1.2              | PB55     | 198      | 2.88                | -0.5              |
| CR50     | 37       | 0.04                | 0.0               | PB59     | 200      | 2.86                | -0.3              |
| CR51     | 107      | 0.04                | 0.2               | PB67     | 195      | 3.32                | -0.3              |
| CR53     | 180      | 0.02                | 0.1               | PB68     | 202      | 2.57                | 0.0               |
| CR54     | 185      | 2.81                | -0.9              | PB69     | 201      | 2.82                | -0.1              |
| CW05     | 185      | 0.02                | 0.1               | PB70     | 204      | 2.72                | -0.3              |
| CW06     | 59       | 0.05                | 0.1               | PB71     | 197      | 2.90                | 0.0               |
| FT06     | 191      | 2.48                | -1.1              | PB72     | 206      | 2.73                | 0.3               |
| FT09     | 148      | 0.02                | 0.2               | PB73     | 190      | 2.49                | -0.4              |
| KC02     | 193      | 1.30                | 0.0               | PB74     | 193      | 3.08                | -0.4              |
| KC05     | 215      | 0.55                | 0.0               | PB75     | 193      | 2.89                | -0.1              |
| KC06     | 256      | 0.94                | -0.4              | UB02     | 189      | 2.74                | 0.2               |
| KC07     | 135      | 0.01                | 0.0               | *PVE3RP  | 0        | 0                   | 0.1               |

**October 10, 2023 to January 13, 2024 Movement Distances (Feet) & Directions as Indicated**

*Note: Movement distances exaggerated 100x for viewing*

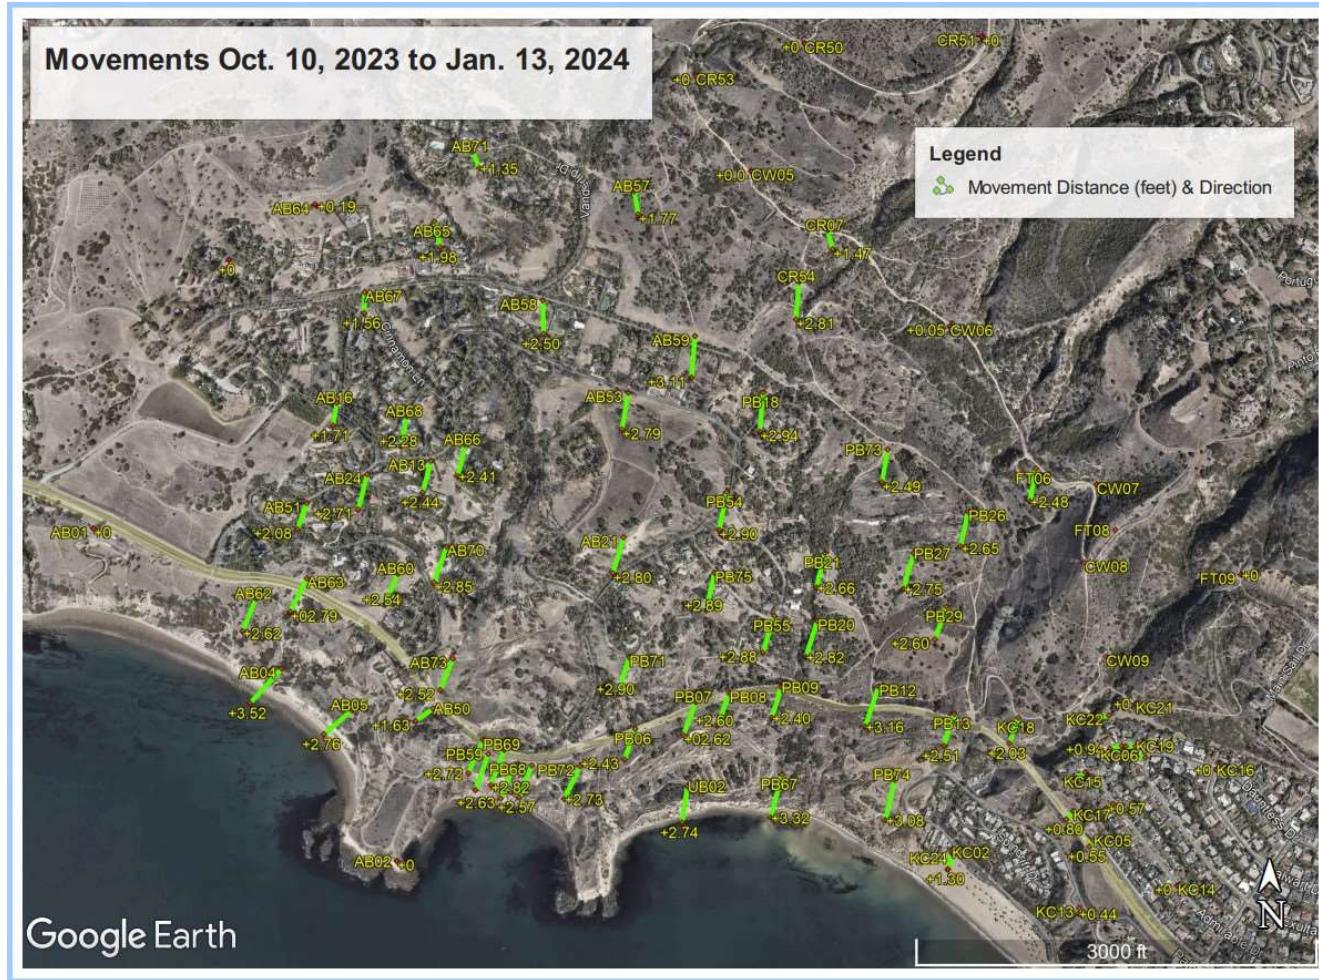

**Enlargement (PVDS)**



**Enlargement (Seaview)**



## **ASSESSMENT of MOVEMENT VELOCITIES & ACCELERATIONS 2014 to 2024**

Others performed monitoring surveys of the Portuguese Bend land movement between 1994 and 2006. McGee Surveying Consulting assumed responsibility and defensibility for the Portuguese Bend Monitoring Program in 2007. The annual measured movements between 2007 and 2018 were fairly small and stable as shown below by the averages and maximums of a sampling of points for the 2014-2018 period. The fall 2019 monitoring survey found the annual rate of movements (velocities) increased (accelerated) about 4 to 6 times and remained stable for the next four years through 2022. A “year” here is defined as the 12-month period beginning with the rainy season on October 1st.

### **Annual Average Movements in Feet, Maximum Movements & Change in the Average of a Sample of Points**

| ID   | 2014-2018 (4 Yrs) |      | 2018-2022 (4 Yrs) |      | Change in Average |
|------|-------------------|------|-------------------|------|-------------------|
|      | Average           | Max. | Average           | Max. |                   |
| AB20 | 0.09              | 0.20 | 0.48              | 0.54 | +5X               |
| AB53 | 0.07              | 0.18 | 0.43              | 0.49 | +6X               |
| AB68 | 0.05              | 0.11 | 0.31              | 0.32 | +6X               |
| CR07 | 0.06              | 0.13 | 0.30              | 0.32 | +5X               |
| KC06 | 0.04              | 0.09 | 0.16              | 0.22 | +4X               |
| PB55 | 0.89              | 1.31 | 0.89              | 1.23 | +1X (No Change)   |

In the following twelve months between October 2022 and October 2023, the annual rate of movements were found to have again accelerated. The table below shows a sample of points within Abalone Cove (AB), Klondike Canyon (KC) and Portuguese Bend (PB). The left half of the table compares the annual movements and rate of movements per month for the October 2021 to October 2022 with the October 2022 to October 2023 period. The annual rate of movement for the sample averages in each slide increased about 6x for AB, 8x for KC and 5x for PB.

In the same 12-month period between October 2022 and October 2023, accelerations were noted in the first seven months over the previous year and again in the last five months over the previous seven months as shown in the right half of the table below. The average rate of movement in each slide for these samples in the first seven months October 2022 through April 2023 increased about 3x for AB, 4x for KC and 2x for PB over the previous 12-month period of October 2021 to October 2022. The average rate of movements in each slide for the samples in the last five months May 2023 to October 2023 increased 4x for AB, 4x for KC and 3x for PB over the previous seven months.

| October 2021 to October 2023 Movements & Rates per Month (Feet) |                    |                   |                    |                   |                   |              |                   |              |
|---|--------------------|-------------------|--------------------|-------------------|-------------------|--------------|-------------------|--------------|
| Point   | M32 > M34 (12 Mo.) |                   | M34 > M38 (12 Mo.) |                   | M34 > M36 (7 Mo.) |              | M36 > M38 (5 Mo.) |              |
|   | Oct '21 > Oct '22  | Oct '22 > Oct '23 | Oct '22 > May '23  | May '22 > Oct '23 | Movement          | Rate/Mo      | Movement          | Rate/Mo      |
|   | Movement           | Rate/Mo           | Movement           | Rate/Mo           | Movement          | Rate/Mo      | Movement          | Rate/Mo      |
| AB20  | 0.51               | 0.042             | 3.06               | 0.255             | 0.84              | 0.119        | 2.22              | 0.444        |
| AB53  | 0.49               | 0.041             | 2.75               | 0.229             | 0.74              | 0.105        | 2.01              | 0.403        |
| AB58  | 0.41               | 0.034             | 2.22               | 0.185             | 0.60              | 0.085        | 1.62              | 0.325        |
| AB60  | 0.45               | 0.038             | 2.69               | 0.224             | 0.80              | 0.114        | 1.90              | 0.379        |
| AB67  | 0.18               | 0.015             | 1.12               | 0.094             | 0.32              | 0.046        | 0.80              | 0.160        |
| AB68  | 0.32               | 0.027             | 2.03               | 0.169             | 0.54              | 0.077        | 1.49              | 0.299        |
| AB70  | 0.48               | 0.040             | 2.97               | 0.248             | 0.84              | 0.120        | 2.14              | 0.427        |
| CR07  | 0.31               | 0.026             | 1.87               | 0.156             | 0.44              | 0.062        | 1.43              | 0.287        |
| <b>Av Move</b>  | <b>0.39</b>        | <b>0.033</b>      | <b>2.34</b>        | <b>0.195</b>      | <b>0.64</b>       | <b>0.091</b> | <b>1.70</b>       | <b>0.340</b> |
|   |                    |                   |                    |                   |                   |              |                   |              |
| KC06  | 0.16               | 0.014             | 1.34               | 0.111             | 0.33              | 0.047        | 1.01              | 0.202        |
| KC13  | 0.09               | 0.007             | 0.70               | 0.058             | 0.19              | 0.027        | 0.51              | 0.102        |
| KC17  | 0.14               | 0.012             | 1.24               | 0.104             | 0.31              | 0.044        | 0.93              | 0.187        |
| <b>Av Move</b>  | <b>0.13</b>        | <b>0.011</b>      | <b>1.09</b>        | <b>0.091</b>      | <b>0.27</b>       | <b>0.039</b> | <b>0.82</b>       | <b>0.163</b> |
|   |                    |                   |                    |                   |                   |              |                   |              |
| PB55  | 0.80               | 0.067             | 3.86               | 0.321             | 1.06              | 0.151        | 2.80              | 0.560        |
| PB70  | 0.72               | 0.060             | 3.58               | 0.299             | 1.14              | 0.163        | 2.44              | 0.488        |
| <b>Av Move</b>  | <b>0.76</b>        | <b>0.063</b>      | <b>3.72</b>        | <b>0.310</b>      | <b>1.10</b>       | <b>0.157</b> | <b>2.62</b>       | <b>0.524</b> |

### **Movement & Rate of Movement per Month**

In the last 3-month period October 10, 2023 to January 13, 2024, accelerations were noted again relative to the previous 12-months. The average rate of movements in each slide for the last 3-months for these samples increased about 4x for AB, 3x for KC and 3x for PB over the previous 12-month period of October 2022 to October 2023.

| Point          | M38 > M39 (3.1 Mo.)               |              |
|----------------|-----------------------------------|--------------|
|                | Oct. 10, 2023<br>to Jan. 13, 2024 | Movement     |
| <b>AB20</b>    | 2.80                              | 0.903        |
| <b>AB53</b>    | 2.79                              | 0.900        |
| <b>AB58</b>    | 2.50                              | 0.806        |
| <b>AB60</b>    | 2.54                              | 0.819        |
| <b>AB67</b>    | 1.56                              | 0.503        |
| <b>AB68</b>    | 2.28                              | 0.735        |
| <b>AB70</b>    | 2.85                              | 0.919        |
| <b>CR07</b>    | 1.47                              | 0.474        |
| <b>Average</b> | <b>2.35</b>                       | <b>0.758</b> |
|                |                                   |              |
| <b>KC06</b>    | 0.94                              | 0.303        |
| <b>KC13</b>    | 0.44                              | 0.142        |
| <b>KC17</b>    | 0.80                              | 0.258        |
| <b>Average</b> | <b>0.73</b>                       | <b>0.236</b> |
|                |                                   |              |
| <b>PB55</b>    | 2.88                              | 0.929        |
| <b>PB70</b>    | 2.72                              | 0.877        |
| <b>Average</b> | <b>2.80</b>                       | <b>0.903</b> |

### **RECOMMENDATION**

Continuity in the methods, precision and reporting of the monitoring surveys are necessary to evaluating results relative to and consistent with prior 2007-2024 monitoring survey campaigns. Monitoring survey campaigns require the services of an independent GNSS/Geodetic expert to evaluate and validate results to assure program integrity and defensibility.

Maintaining a clearing of foliage in a 10' radius around monitoring points and trimming nearby trees and brush above eye height is necessary to assure a clear view of the sky for tracking satellites. Satellites, although unseen, can appear anywhere in the sky above the horizon and the radio signals passing through foliage degrade the required survey accuracy and productivity. Presently, Points AB04, AB13, AB17, AB24, AB51, AB58, AB66, PB18, PB54, CR51 and CR53 have foliage obstructions limiting sky (satellite) visibility and require clearing prior to the next survey.

## Addendum No. 2 Report

### **Portuguese Bend Land Movement Monitoring Survey Partial Monitoring Survey No. M40 – March 8, 2024**

This is the mid-winter Partial Monitoring Survey No. M40 Report. The average date of the survey is March 8, 2024, 1.8 months after the January 13, 2024 Full Monitoring Survey. The survey included 44 monitoring points and 3 reference control points. Occupying a central base station (usually AB73) was not feasible due to the excessive rate of land movement and reliance was made on the remote Smartnet RTN Stations which resulted in a lesser accuracy. For this survey, this was not an issue since the signal (measured movement) was much greater than the noise of the measurements expected to be about less than 0.05'.

A typical minimally constrained network adjustment, as described above for survey M38, was processed for M40 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights. The adjustment fixed point PVE3RP and checked to other points expected to be and found stable. Differences from the known fixed positions to the measured positions in this survey are listed here with their north, east and vertical components in feet.

| ID     | Differences in Feet |      |       |
|--------|---------------------|------|-------|
|        | dN                  | dE   | dZ    |
| PVE3RP | 0.00                | 0.00 | 0.00  |
| AB02   | 0.02                | 0.01 | -0.09 |
| RP01   | 0.00                | 0.02 | -0.10 |

Fixed Reference at City Hall  
Check Point on Portuguese Point  
Check Point at Trump Golf Course

The successful recovery of a stable horizontal reference frame confirmed. The Z height variations are attributed to the noise in the Smartnet Network solution. RP01 is intended to replace AB02.

### **2D Horizontal & Vertical Movements for 1.8 Months January 13, 2024 (M39) to March 8, 2024 (M40)**

The general rate of land movement increased significantly over the January 13, 2024 survey assessment. See the attached spreadsheet “PB MOVEMENT DATA POSTING.... .xlsx” for the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See also the column for the rate of movement for each period annualized for an average month.

### **Accuracy Statements**

The horizontal (2D) vector residuals averaged 0.04 feet with a Standard Deviation of 0.03 feet. The absolute value of the vertical residuals averaged 0.04 feet with a Standard Deviation of 0.03 feet.

At the 95% Level of Confidence, the accuracy of the horizontal (2D) movements is estimated to be less than 0.04'. Movements of less than 0.05' are statistically indeterminate. The estimated vertical measured movement confidence is 0.06' to 0.09'.

## Addendum No. 3 Report

### **Portuguese Bend Land Movement Monitoring Survey Partial Monitoring Survey No. M41 – April 17, 2024**

This is the Spring Partial Monitoring Survey No. M41 Addendum Report. The field survey took place April 16-18, 2024, average date of April 17, 2024, 1.35 months after the last March 8, 2024 Monitoring Survey. The survey included 55 monitoring points and 3 reference control points. Eleven new monitoring points were set and surveyed. The location of two new points were identified and will be surveyed on the next campaign in late May after the monuments are set by others. See the points descriptions below.

**McGEE SURVEYING CONSULTING**  
5290 Overpass Road, Ste#107, Santa Barbara, CA 93111

Occupying previous base stations was not feasible due to the excessive rate of land movement. The Smartnet RTN Network does not require a base station but results in a somewhat lesser accuracy. Smartnet may be used in the future; however, it was deemed beneficial to establish a new base station outside the slide complex to facilitate future surveys. A new base station point "RP02" was set westerly of the slide complex and north of Abalone Cove Park.

A typical minimally constrained adjustment, as described above for the M38 survey, was processed for M41 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights. A least squares network adjustment was fixed at point PVE3RP to establish a position on the base at RP02 and thereby all other points in the survey. A check to RP01 easterly outside the slide complex was made as noted below. This process will be the standard on future surveys. Differences from the known fixed positions to the measured positions in this survey are listed here with their north, east and vertical components in feet.

| Differences in Feet |       |      |       |
|---------------------|-------|------|-------|
| ID                  | dN    | dE   | dZ    |
| PVE3RP              | 0.00  | 0.00 | 0.00  |
| RP01                | -0.01 | 0.00 | -0.03 |

Fixed Reference at City Hall  
Check Point at Trump Golf Course

The successful recovery of a stable horizontal reference frame is confirmed. Point AB02 replaced by RP01, was used in previous surveys to also confirm recovery of the reference frame has limited access do to the slides.

### **2D Horizontal & Vertical Movements for 1.35 Months March 8, 2024 (M40) to April 17, 2024 (M41)**

The general rate of land movement increased significantly over the March survey. On average the velocities increased 76% with a maximum of 143%. Eight points doubled their velocities in the last six weeks over the previous eight weeks. In Abalone Cove and Portuguese Bend Slides many points are moving about three feet per month and in the Seaside Klondike Canyon Slide about  $\frac{3}{4}$  of a foot per month. See the attached spreadsheet "PB MOVEMENT DATA POSTING.... .xlsx" for the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See also the column for the rate of movement for each period annualized for an average month.

### **Accuracy Statements**

The horizontal (2D) vector residuals averaged 0.04 feet with a Standard Deviation of 0.03 feet. The absolute value of the vertical residuals averaged 0.04 feet with a Standard Deviation of 0.03 feet.

The land is moving 0.05' to 0.10' daily. Most points are measured a day apart resulting in large residuals but accurate positions of the mean coordinate. Therefore, it is at estimated the 95% Level of Confidence, the accuracy of the horizontal (2D) movements is estimated to be less than 0.03'. Movements of less than 0.04' are statistically indeterminate. The estimated vertical measured movement confidence is 0.05' to 0.10'.

### **Monitoring Point Monument Descriptions**

See prior Reports for all other Point Descriptions. See the attached spreadsheet file "PB MOVEMENT DATA POSTING...." for California State Plane Coordinates Zone 5 in the NAD83 (2007) Epoch 2007.00 and NAVD88 Datums n

#### **Point Description of Points added in April 2024**

|      |   |
|------|---|
| AB74 | 8" Spike set as temporary monument to be replaced with a 2" GIP by others       |
| AB75 | 8" Spike set as temporary monument to be replaced with a 2" GIP by others       |
| AB76 | 8" Spike set as temporary monument to be replaced with a 2" GIP by others       |
| AB77 | Location identified, 2" GIP to be set by others                                 |
| CR55 | Set Mag Nail drilled in a Concrete walk/valley gutter                           |
| CR56 | Location identified, 2" GIP to be set by others                                 |
| KC25 | Set Mag Nail drilled in a concrete & rock wall                                  |
| KC26 | Set Mag Nail drilled in a concrete wall   |
| KC27 | Set Mag Nail drilled in a concrete 6' fire pit                                  |
| KC28 | Set Mag Nail drilled in a concrete headwall                                     |
| KC29 | Set Mag Nail drilled in a concrete headwall                                     |
| KC30 | 8" Spike set as temporary monument to be replaced with a 2" GIP by others       |
| KC31 | 8" Spike set as temporary monument to be replaced with a 2" GIP by others       |
| RP02 | 1/2" x 4" rebar in large sloping meadow with T-bar witness for new base station |

## Addendum No. 4 Report

### **Portuguese Bend Land Movement Monitoring Survey**

**Full Monitoring Survey No. M42 – May 28, 2024**

This is Full Monitoring Survey No. 42 Addendum Report. The field survey took place May 27-30, 2024, with an average date of May 28, 2024, 1.35 months after the last April 17, 2024 Partial Monitoring Survey. The survey included 93 monitoring points and 3 reference control points. Two new monitoring points (AB77 & CR56) were set and surveyed. Seven temporary monuments were reset with a permanent monument. Monuments CW01, CW07 and CW08, set in 2022 for CalWater, were adopted for the purpose of these surveys. See the point descriptions below.

There are 14 monitoring points in the upper portion of the Reserve which are now difficult and time consuming to access due to the slides. An assistant provided by sub-contractor Chris Nelson & Associates (CNA) has been assigned these locations beginning with this May survey. CNA conducted their survey measurements with a Trimble R12 referenced to the Smartnet RTN for positioning. These monitoring point observations were referenced to the RPV Portuguese Bend network by way of connections to RP01, RP02 & PVE3RP. In the late June survey, CAN will be using Leica instrument similar to those used by McGee Surveying Consulting to assure the highest precision and increased productivity.

A minimally constrained adjustment, as described above for the above M38 Survey Report, was processed for M42 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights. A least squares network adjustment was fixed at point PVE3RP to establish a position on the base at RP02 and thereby all other points in the survey. A check to RP01 easterly outside the slide complex and other nearly stable points were made as noted below. Differences from the known fixed positions to the measured positions by this survey are listed here with their north, east and vertical components in feet.

| Differences in Feet |       |       |       |
|---------------------|-------|-------|-------|
| ID                  | dN    | dE    | dZ    |
| PVE3RP              | -0.00 | -0.00 | -0.00 |
| RP01                | -0.00 | 0.01  | -0.01 |
| RP02                | -0.03 | 0.02  | -0.01 |
| AB02                | 0.00  | -0.02 | 0.09  |

The successful recovery of a stable reference frame is confirmed. Point RP01 is intended to supersede AB02 used in previous surveys to confirm recovery of the reference frame. AB02 now has limited access do to the slides. Additionally, California Spatial Reference Center CGPS (Continous Operating GPS Stations) PVE3 and PVHS are incorporated from time to time to verify the stability of the refence frame.

### **2D Horizontal & Vertical Movements for 1.35 Months April 17, 2024 (M41) to May 28, 2024 (M42)**

The general rate of land movement increased in the last six weeks over the April survey. On average the velocities increased about 40% which is an increased rate of movement; however, the rate of acceleration is less than the estimated average of 76% in the previous six weeks. See the attached spreadsheet “PB MOVEMENT DATA POSTING.... .xlsx” for the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See also the column for the rate of movement for each period annualized for an average 30.42-day month.

### **Accuracy Statements**

The horizontal (2D) vector residuals are estimated at 0.02 feet with a Standard Deviation of 0.03 feet. The absolute value of the vertical residuals are estimated at 0.03 feet with a Standard Deviation of 0.04 feet.

The rate of land movement varies and is as much as 0.12' daily. It is estimated at the 95% Level of Confidence, the accuracy of the horizontal (2D) movements is estimated to be 0.04-0.06'. Movements less than the

**McGEE SURVEYING CONSULTING**  
5290 Overpass Road, Ste#107, Santa Barbara, CA 93111

Confidence Interval are statistically indeterminate. The estimated vertical measured movement confidence is 0.05' to 0.10'.

**Monitoring Point Monument Descriptions**

See prior Reports for all other Point Descriptions. See the attached spreadsheet file "PB MOVEMENT DATA POSTING...." for California State Plane Coordinates Zone 5 in the NAD83 (2007) Epoch 2007.00 and NAVD88 Datums n

## **Addendum No. 5 Report**

### **Portuguese Bend Land Movement Monitoring Survey** **Full Monitoring Survey No. M43 – July 1, 2024**

This is Full Monitoring Survey No. 43 Addendum Report. The field survey took place June 30, 2024 to July 3, 2024 with an average date taken as July 1, 2024, 1.12 months after the last May 28 Monitoring Survey. The survey included 93 monitoring points and 3 reference control points.

14 monitoring points in the upper portion of the Reserve require about three miles of hiking to access due to the slides. An assistant provided by sub-contractor Chris Nelson & Associates (CNA) is assigned these locations. A loaner GS18 Leica instrument same as used by McGee Surveying Consulting (MSC) and connected to MSC's RTK base station is utilized to assure the highest precision and increased productivity.

A minimally constrained adjustment, as described above for the above M38 Survey Report, was processed for M43 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights. A least squares network adjustment was fixed at point PVE3RP to establish a position on the base at RP02 and thereby all points in the survey. A check to RP01 easterly outside the slide complex, AB02 and other nearly stable points were made as noted below. Differences from the known fixed positions to the measured positions by this survey are listed here with their north, east and vertical components in feet.

| Differences in Feet |       |       |       |                                |
|---------------------|-------|-------|-------|--------------------------------|
| ID                  | dN    | dE    | dZ    |                                |
| PVE3RP              | -0.00 | -0.00 | -0.00 | Fixed Reference at City Hall   |
| RP01                | +0.01 | -0.01 | -0.00 |                                |
| RP02                | -0.03 | 0.02  | -0.01 |                                |
| AB02                | -0.01 | -0.02 | +0.03 |                                |
| PVE3                | +0.01 | +0.00 | -0.11 | CSRC CGPS Station at City Hall |

Recovery and confirmation of a stable reference frame is essential to assess the actual movement of the monitoring points. The differences listed above are at the noise level of the measurements confirming a successful recovery of the reference frame. Because AB02 has limited access due to the slides, Point RP01 is intended to supplement AB02 used in previous surveys to confirm recovery of the reference frame. Additionally, California Spatial Reference Center CGPS (Continuous Operating GPS Stations) PVE3 and PVHS are incorporated to verify the stability and recovery of the reference frame.

**2D Horizontal & Vertical Movements for 1.12 Months M42 to M43**

The rate of land movement varies and averages about 3 feet per average month with a maximum of 4.88 feet. The general rate of land movement increased about 25% on average; however, the rate of acceleration is less as indicated by the estimated average increase of 41% in the rate of land movement in the previous month. See the attached spreadsheet "PB MOVEMENT DATA POSTING.... .xlsx" for the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, and the vertical (elevation) changes during the period in US Survey Feet. See also the column for the rate of movement for each period annualized for an average 30.42-day month.

### **Accuracy Statements**

The horizontal (2D) vector residuals are estimated at 0.02 feet with a Standard Deviation of 0.03 feet. The absolute value of the vertical residuals are estimated at 0.03 feet with a Standard Deviation of 0.04 feet.

It is estimated at the 95% Level of Confidence, the accuracy of the horizontal (2D) movements is estimated to be 0.04-0.06'. Movements less than the Confidence Interval are statistically indeterminate. The estimated vertical measured movement confidence is 0.05' to 0.10'.

### **Monitoring Point Monument Descriptions**

See prior Reports for Point Descriptions. See the attached spreadsheet file "PB MOVEMENT DATA POSTING...." for California State Plane Coordinates Zone 5 in the NAD83 (2007) Epoch 2007.00 and elevations in the NAVD88 Datum.

#### Point Description: Update of Points set in April & May

|      |   |
|------|---|
| AB74 | 1/2" x 4' rebar encased in concrete witnessed by a steel t-bar post                         |
| AB75 | 1/2" x 4' rebar encased in concrete witnessed by a steel t-bar post                         |
| AB76 | 1/2" x 4' rebar encased in concrete witnessed by a steel t-bar post                         |
| AB77 | 1" x 24" GIP with cap "Control Point" encased in concrete witnessed by a steel t-bar post   |
| CR56 | 1" x 24" GIP with cap "Control Point" encased in concrete witnessed by a steel t-bar post   |
| CW07 | 1/2" x 4' punched rebar in concrete with T-bar witness post                                 |
| CW08 | 1/2" x 4' punched rebar in concrete with T-bar witness post                                 |
| KC30 | 1/2" x 4' rebar encased in concrete witnessed by a steel t-bar post                         |
| KC31 | 8" spike set between two steel posts in line with a string of boulders                      |
| RP02 | 1/2" x 4' punched rebar in concrete in large sloping meadow witnessed by a steel T-bar post |

## **Addendum No. 6 Report**

### **Portuguese Bend Land Movement Monitoring Survey** **Full Monitoring Survey No. M44 – August 1, 2024**

This is Full Monitoring Survey No. 44 Addendum Report. The field survey took place July 30, 2024 to August 3, 2024 with an average date taken as August 1, 2024, 1.02 months after the last July 1 Monitoring Survey. The survey included 98 monitoring points and 3 reference control points (RP01, RP02 & AB02).

15 monitoring points in the upper portion of the Reserve some requiring substantial hiking for access due to the slides. An assistant provided by sub-contractor Chris Nelson & Associates (CNA) is assigned these locations.

A minimally constrained adjustment, as described above for the above M38 Survey Report, was processed for M44 to develop NAD83 (2007) Epoch 2007.00 CA Zone 5 State Plane Coordinates and NAVD88 Heights. A least squares network adjustment was fixed at point PVE3RP to verify and establish a position on the base station point RP02 and thereby all points in the survey. A check to RP01 easterly outside the slide complex, AB02 and other nearly stable points were made as noted below. Differences from the known fixed positions to the measured positions by this survey are listed here with their north, east and vertical components in feet.

| Differences in Feet |       |       |       |                               |
|---------------------|-------|-------|-------|-------------------------------|
| ID                  | dN    | dE    | dZ    |                               |
| PVE3RP              | -0.00 | -0.00 | -0.00 | Fixed Reference at City Hall  |
| RP01                | 0.03  | -0.03 | 0.01  | Check Point                   |
| RP02                | -0.00 | 0.01  | 0.07  | Base Station                  |
| AB02                | -0.01 | 0.00  | 0.07  | Check Point                   |
| AB17                | 0.00  | 0.00  | 0.05  | Point Historically Not Moving |
| CW01                | 0.01  | 0.02  | 0.11  | Point Historically Not Moving |
| KC16                | 0.00  | 0.01  | 0.10  | Point Historically Not Moving |

**McGEE SURVEYING CONSULTING**  
5290 Overpass Road, Ste#107, Santa Barbara, CA 93111

Recovery and confirmation of a stable reference frame is essential to assess the actual movement of the monitoring points. The differences listed above are at the noise level of the measurements confirming a successful recovery of the reference frame. Because AB02 has limited access do to the slides, Point RP01 is intended to supplement AB02 used in previous surveys to confirm recovery of the reference frame. Additionally, California Spatial Reference Center CGPS (Continous Operating GPS Stations) PVE3 and PVHS are incorporated at times for additional verification of the stability and recovery of the reference frame.

**2D Horizontal & Vertical Movements for 1.02 Months M43 to M44**

The rate of land movement varies and averaged about 2.4 feet per average month in the last period with a maximum of 4.69 feet per month. The general rate (velocity) of land movement varied from about -13% to +13% and averaged nearly zero. See the attached spreadsheet “PB MOVEMENT DATA POSTING.... .xlsx” for the movement Azimuths (directions clockwise from North) in degrees, the two-dimensional horizontal movements, vertical (elevation) changes during the period in US Survey Feet. See also the column for the rate of movement for each period annualized for an average 30.42-day month.

**Accuracy Statements**

The horizontal (2D) vector residuals are estimated at 0.02 feet with a Standard Deviation of 0.03 feet. The absolute value of the vertical residuals are estimated at 0.03 feet with a Standard Deviation of 0.04 feet.

It is estimated at the 95% Level of Confidence, the accuracy of the horizontal (2D) movements is estimated to be 0.04'. Movements less than the Confidence Interval are statistically indeterminate. The estimated vertical measured movement confidence is about 0.05' to 0.10'.

**Monitoring Point Monument Descriptions**

See prior Reports for Point Descriptions. See the attached spreadsheet file “PB MOVEMENT DATA POSTING....” for California State Plane Coordinates Zone 5 in the NAD83 (2007) Epoch 2007.00 and elevations in the NAVD88 Datum.

**Point Description: Update of Points set in August**

|      |  |
|------|--|
| AB78 | 2" Magnetic Nail drilled in a concrete curb on the N. side of Vanderlip Dr., replaced AB71 |
| CR57 | ½" x 4' punched rebar in concrete with T-bar witness post, replaces CR07                   |
| KC34 | 2" Magnetic Nail set in Stalwart Dr. East of Schooner Dr.                                  |
| KC35 | 2" Magnetic Nail set in Xn of Schooner & Stalwart Dr.                                      |
| KC36 | 2" Magnetic Nail set in Xn of Schooner & Admirable Dr.                                     |
| KC37 | Punch mark on north side Sewer MH in Admirable Dr. East of Schooner Dr.                    |

**SURVEYOR'S STATEMENT**

The M38 Fall October 2023 Full Survey and subsequent 2024 Surveys and Addendum Reports on the procedures, criteria, and results of the City of Rancho Palos Verdes Portuguese Bend Land Movement Monitoring Surveys were prepared by me on October 30, 2023 and updated August 15, 2024 at the request of Ramzi Awwad, Director of Public Works for the City of Rancho Palos Verdes.

  
Michael R. McGee, PLS3945

